

## **USING THE HIGHWAY SAFETY RESEARCH CENTER CHILD RESTRAINT RECALL LIST**

**Last Revisions – Newer Model List: November 20, 2009**  
**Older Model List: October 29, 2009**

### **About Child Restraints and Recalls**

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Many recalls are issued due to reasons related to the crashworthiness of the child restraint, but some recalls are for deviations from the standards relating to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Child restraints (CRs) are required to have a label indicating the manufacturer, model information, and date of manufacture. CRs should not be used if the labels are missing such that the manufacturer, model name, number, and date of manufacture cannot be determined.

Child restraint manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the restraints unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current restraint or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected child restraint or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236.

### **About Older Child Restraints and Recalls**

Child restraints manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years and some child restraints are stamped with an expiration date. Parents and other caregivers are encouraged to contact the child restraint manufacturer for model specific recommendations.

Older models, those manufactured since 1981, are included as a part of the HSRC recall list because parents and other care givers will sometimes choose to use child restraints older than ten years even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect can be corrected, should help to encourage the care giver to destroy the older CR and obtain a new one.

## About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) child restraint (CR) recall list identifies recalls and safety notifications for child restraint systems known by the HSRC at the time it is published. This list is updated by HSRC as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. To be notified via email whenever the HSRC Recall List is updated, go to [www.hsrc.unc.edu/recalls](http://www.hsrc.unc.edu/recalls) and click on the link to "Sign up for automatic email notification of updates to the HSRC recall list."

The HSRC recall list is formatted in a relatively compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this list are encouraged to obtain more detailed information about recent recalls through the "Most Recent Car Seat Recall Announcements and Notices" page of the HSRC Recall List website. Users of this (or any other) recall list should remind parents/caregivers to contact the CR manufacturer to be certain whether or not a particular CR is affected by any recalls.

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of child restraints where most or all of the effected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised.

## Instructions for Using the PDF Version of the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the child restraint itself. Using this information:

1. Look to see if the manufacturer and model name and/or model number are listed in the index\*. **Child restraints under recall are listed in the index by both model name and model number.** Each entry on the list and in the index is assigned a "List #" based on its location in the list. The list is alphabetized by manufacturer and model name. List #'s for individual models will change in subsequent lists as models are added to or removed from the list.
2. If that model name or model number is listed in the index, note the "List # (number)" and use the List # to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the child restraint.
3. If the restraint is included in the recall, the CR manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
4. If the manufacturer has gone out of business or discontinued their repair or replacement program, the CR should be destroyed after a replacement restraint is obtained.
5. If the restraint is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the restraint's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

\*Note that Dorel Juvenile Group (DJG) products are indexed under each individual product line (Alpha Elite, Beatrix Potter, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1st) as well as under the broader "Dorel" label.

For further information, contact:

Bill Hall

The University of North Carolina Highway Safety Research Center  
CB# 3430, Chapel Hill, NC 27599  
919-962-2202 or (in NC) 800-672-4527 or [bill\\_hall@unc.edu](mailto:bill_hall@unc.edu)

The following lists identify recalls and safety notifications for child restraints (CRs) known by the UNC Highway Safety Research Center (HSRC) as of November 20, 2009. This list is updated by HSRC as soon as possible after recall notifications are announced. Updated versions are available on-line at [www.hsrc.unc.edu](http://www.hsrc.unc.edu) or by phone at 919-962-2202 or 800-672-4527 (in NC). The most recent addition(s) to the list is/are denoted by ">>".

CRs are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. Model numbers followed by one or more "x" should be read as "model numbers beginning with." If the label is missing on your CR, contact the manufacturer to see if it can be identified through other information. **A CR should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

CRs manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Models older than ten years and under recall are included on a separate list with a separate index.** The index for older models can be found following the last page of the "Models Less Than 10 Years Old" recall list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised October 29, 2009.**

Some of the recalls/notifications for CRs on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific CR is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current CR or to obtain another one until the problem can be corrected.

**In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the CR and obtain and use another one as soon as possible.** Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded CRs should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected safety seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236.

## CHILD RESTRAINTS LESS THAN 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names. **Note:** Dorel Juvenile Group products are indexed under each individual product line (Alpha Elite, Beatrix Potter, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1<sup>st</sup>) as well as under "Dorel."

<p><b>Alcot</b> ALL MODELS ..... 1</p> <p><b>All Our Kids</b> ALL MODELS ..... 2</p> <p><b>Alpha Elite (Dorel)</b> # 22331 BLA ..... 3, 4 # 22332 RLA ..... 3, 4 Comfort Infant Seat ..... 3, 4</p> <p><b>American Motors</b> ALL MODELS ..... 5</p> <p><b>Baby Trend</b> # 6400 ..... 7 # 6439 ..... 6 # 6448 ..... 6</p>	<p># 6481 ..... 6 Rigid Latch-Loc ..... 6 Rigid Latch-Loc Base ..... 7</p> <p><b>Babyhood Industries</b> ALL MODELS ..... 8</p> <p><b>Basic Comfort</b> ALL MODELS ..... 9</p> <p><b>Beatrix Potter (Dorel)</b> # 02-620-xxx ..... 10 # 02-621-SAL ..... 10 Designer 22 ..... 10</p> <p><b>Bolform</b> ALL MODELS ..... 11</p>	<p><b>Britax</b> # E902228 ..... 12 # E9031 ..... 26, 27 # E906 ..... 23 # E9L06 ..... 23 # E9L07 ..... 29 # E9L14 ..... 14, 15, 16 # E9L20 ..... 15, 16 # E9L30 ..... 20, 21, 22 # E9L32 ..... 28 # E9L3998 ..... 24 # E9L39x ..... 25 # E9L47 ..... 17 # E9L5490 ..... 19 # E9L54E7 ..... 18, 19 # E9L54H6 ..... 18 # E9L54H7 ..... 18 # E9L54M6 ..... 18</p>
--	--	---

<b>Britax (continued)</b>		# I420 MAR	40	<b>Dorel</b>	
# E9L57	13	Infant Car Seat	40	# 02-331 (Cosco)	41
# E9L80	15, 16			# 02-331 (Eddie Bauer)	51
# E9W06	23	<b>Cosco</b>		# 02-332 (Cosco)	41
Advantage	12	# 02-331	41	# 02-332 (Eddie Bauer)	51
Boulevard	13	# 02-332	41	# 02-531 (Cosco)	41
Companion	14, 15, 16	# 02-531	41	# 02-531 (Eddie Bauer)	51
Decathlon	17	# 02-533	41	# 02-533 (Cosco)	41
Frontier	18, 19	# 02-537	41	# 02-533 (Eddie Bauer)	51
Husky	20, 21	# 02-665	43	# 02-537 (Cosco)	41
Marathon	22, 23	# 02-667	49	# 02-537 (Eddie Bauer)	51
Regent	24, 25	# 02-727	43	# 02-555 (Cosco)	41
Super Elite	26, 27	# 02-728	43	# 02-555 (Eddie Bauer)	51
Traveller Plus	28	# 02-729	43	# 02-620-xxx (Beatrix Potter)	10
Wizard	29	# 02-731	43	# 02-620-xxx (Safety 1st)	106
		# 02-732	43	# 02-621-SAL (Beatrix Potter)	10
<b>Century</b>		# 02-733	43	# 02-621-SAL (Safety 1st)	106
# 44612	32	# 02-750	43	# 02-665 (Cosco)	43
# 44622	31	# 02-751	43	# 02-667 (Cosco)	49
# 44630	31	# 02-753	49	# 02-727 (Cosco)	43
# 44631	31	# 02-755	43	# 02-728 (Cosco)	43
# 44662	31	# 02-756	43, 49	# 02-729 (Cosco)	43
# 44709	33	# 02-757	43	# 02-731 (Cosco)	43
# 45100	30	# 02-758	49	# 02-732 (Cosco)	43
# 45200	30	# 02-759	49	# 02-733 (Cosco)	43
# 45600	30	# 02-760	49	# 02-750 (Cosco)	43
# 45700	30	# 02-761	49	# 02-751 (Cosco)	43
# 4662	32	# 02-762	49	# 02-753 (Cosco)	49
Accel	30	# 02-763	49	# 02-755 (Cosco)	43
Bravo	31	# 02-764	49	# 02-756 (Cosco)	43, 49
Encore	32	# 02-765	49	# 02-757 (Cosco)	43
Smart Move	33	# 02-770	49	# 02-758 (Cosco)	49
		# 02-771	49	# 02-759 (Cosco)	49
<b>Chicco</b>		# 02-772	49	# 02-760 (Cosco)	49
# All	34	# 02-774	43	# 02-761 (Cosco)	49
Cortina Travel System	34	# 22-001FSM	45	# 02-762 (Cosco)	49
Key Fit	34	# 22-297	46	# 02-763 (Cosco)	49
Key Fit 30	34	# 22-298	46	# 02-764 (Cosco)	49
		# 22-299	46	# 02-765 (Cosco)	49
<b>Childcare</b>		# 22-300-JOS GB1B	44	# 02-770 (Cosco)	49
ALL MODELS	1	# 22100x	48	# 02-771 (Cosco)	49
		# 22111x	48	# 02-772 (Cosco)	49
<b>Chrysler [Aftermarket]</b>		# 22130x	48	# 02-774 (Cosco)	43
ALL MODELS	35	# 22139MON	47	# 22-001FSM (Cosco)	45
		# 22150	42	# 22-297 (Cosco)	46
<b>Chrysler [Integrated]</b>		# 22155	42	# 22-298 (Cosco)	46
Town and Country	119, 120, 121, 122	# 22180	42	# 22-299 (Cosco)	46
		# 22269	42	# 22-300-JOS GB1B (Cosco)	44
<b>Collier-Keyworth</b>		# 93100x	48	# 22-325 xxx GB1B (Safety 1st)	107
ALL MODELS	36	# 93111x	48	# 22-371 (Eddie Bauer)	84
		Alpha Omega	41, 42	# 22-372 (Eddie Bauer)	84
<b>Combi</b>		Alpha Omega Elite	42	# 22-515 (Eddie Bauer)	84
# 8065	38	Arriva	43	# 22-625 xxx GB1B (Eddie Bauer)	58
# 8074	38	Designer 22	44	# 22100x (Cosco)	48
# 8086	38	DreamRide	45	# 22111x (Cosco)	48
# 8087	39	High Rise Booster	46	# 22130x (Cosco)	48
# 8100	37	Regal Ride	47	# 22139MON (Cosco)	47
# 8520	38	Touriva	48	# 22150 (Cosco)	42
Avatar	37	Turnabout	49	# 22151 (Safety 1st)	104
Centre	38			# 22155 (Cosco)	42
Shuttle	39	<b>Dodge [Integrated]</b>		# 22180 (Cosco)	42
		Caravan	123, 124, 125, 126	# 22269 (Cosco)	42
<b>Compass Baby</b>		Grand Caravan	123, 124, 125, 126	# 22331 BLA (Alpha Elite)	3, 4
# I420 ARD	40			# 22332 RLA (Alpha Elite)	3, 4
# I420 FUO	40				

<b>Dorel (continued)</b>		Alpha Omega . . . . .	53	<b>Ford [Integrated]</b>	
# 22450 (Safety 1st) . . . . .	108	Alpha Omega Elite . . . . .	53	Windstar . . . . .	127
# 22451 (Safety 1st) . . . . .	108	Comfort Infant Seat . . . . .	54, 55	<b>General Motors [Aftermarket]</b>	
# 22452 (Safety 1st) . . . . .	108	Deluxe 3-in-1 . . . . .	56	ALL MODELS . . . . .	72
# 22453 (Safety 1st) . . . . .	108	Deluxe Convertible . . . . .	57	<b>Gerry</b>	
# 22455 (Safety 1st) . . . . .	104	Designer 22 . . . . .	58	ALL MODELS . . . . .	73
# 22460 (Safety 1st) . . . . .	109	Enspira . . . . .	59	<b>Graco</b>	
# 22480 (Safety 1st) . . . . .	108	<b>Evenflo</b>		# 7493 . . . . .	78
# 22481 (Safety 1st) . . . . .	108	# 200x . . . . .	65	# 7497 . . . . .	78
# 22630xxx (Eddie Bauer) . . . . .	54, 55	# 211x . . . . .	65	# 7499 . . . . .	78
# 22631xxx (Eddie Bauer) . . . . .	54, 55	# 264x . . . . .	68, 69	# 8402 . . . . .	79
# 22740 (Eddie Bauer) . . . . .	59	# 272x . . . . .	60	# 8402L . . . . .	79
# 22750 (Eddie Bauer) . . . . .	53	# 273x . . . . .	60	# 8403x . . . . .	79
# 22755 (Eddie Bauer) . . . . .	53	# 3021769Z . . . . .	62	# 841101 . . . . .	78
# 22756 (Eddie Bauer) . . . . .	53	# 3021854Z . . . . .	62	# 841102 . . . . .	78
# 22757 (Eddie Bauer) . . . . .	53	# 317xx . . . . .	63	# 841103 . . . . .	78
# 22770 (Eddie Bauer) . . . . .	53	# 320xx . . . . .	63	# 8412 . . . . .	79
# 93100x (Cosco) . . . . .	48	# 359x . . . . .	68	# 841203 . . . . .	78
# 93111x (Cosco) . . . . .	48	# 3604098 . . . . .	64	# 8412T02 . . . . .	78
3-in-1 (Eddie Bauer) . . . . .	51, 52	# 378x . . . . .	67	# 8433x . . . . .	75
Alpha Elite (Safety 1st) . . . . .	103	# 379x . . . . .	67	# 8442x . . . . .	79
Alpha Omega (Cosco) . . . . .	41, 42	# 389x . . . . .	68	# 8443 . . . . .	79
Alpha Omega (Eddie Bauer) . . . . .	53	# 390 . . . . .	61	# 8443L . . . . .	79
Alpha Omega (Safety 1st) . . . . .	104	# 391 . . . . .	61	# 8444 . . . . .	79
Alpha Omega Elite (Cosco) . . . . .	42	# 397xx . . . . .	63	# 8444L . . . . .	79
Alpha Omega Elite (Eddie Bauer) . . . . .	53	# 398xx . . . . .	63	# 8446 . . . . .	79
Alpha Omega Elite (Safety 1st) . . . . .	104	# 447x . . . . .	65	# 8446L . . . . .	79
Alpha Sport (Safety 1st) . . . . .	105	# 468x . . . . .	60	# 8447 . . . . .	79
Arriva (Cosco) . . . . .	43	# 469x . . . . .	60	# 8447L . . . . .	79
Comfort Infant Seat (Alpha Elite) . . . . .	3, 4	# 476x . . . . .	60	# 8448 . . . . .	79
Comfort Infant Seat (Eddie Bauer) . . . . .	54, 55	# 477x . . . . .	60	# 8448L . . . . .	79
Designer 22 (Beatrix Potter) . . . . .	10	# 478x . . . . .	60	# 8457 . . . . .	78, 79
Designer 22 (Cosco) . . . . .	44	# 480x . . . . .	60	# 8458 . . . . .	78, 79
Designer 22 (Eddie Bauer) . . . . .	58	# 481x . . . . .	60	# 8459 . . . . .	78, 79
Designer 22 (Safety 1st) . . . . .	106, 107	# 499x . . . . .	65	# 8460 . . . . .	78
DreamRide (Cosco) . . . . .	45	# 534 . . . . .	61	# 8462 . . . . .	78
Enspira (Eddie Bauer) . . . . .	59	# 540xx . . . . .	63	# 8463x . . . . .	79
Enspira (Safety 1st) . . . . .	108	# 548xx . . . . .	63	# 8464 . . . . .	79
High Rise Booster (Cosco) . . . . .	46	# 549xx . . . . .	63	# 8470 . . . . .	79
Intera (Safety 1st) . . . . .	109	# 550xx . . . . .	63	# 8471 . . . . .	78, 79
Mico (Maxi-Cosi) . . . . .	84	# 552 . . . . .	61	# 8472 . . . . .	78
Regal Ride (Cosco) . . . . .	47	# 556xx . . . . .	63	# 8473 . . . . .	78
Touriva (Cosco) . . . . .	48	# 597xx . . . . .	63	# 8474 . . . . .	78
Turnabout (Cosco) . . . . .	49	# 598xx . . . . .	63	# 8476 . . . . .	78
<b>Downunder</b>		# 599xx . . . . .	63	# 8477 . . . . .	78
ALL MODELS . . . . .	50	# 639001 . . . . .	66	# 8478 . . . . .	78, 79
<b>Eddie Bauer</b>		# 639002 . . . . .	66	# 8487x . . . . .	74
# 02-331 . . . . .	51	Cozy Carry . . . . .	60	# 8601 . . . . .	79
# 02-332 . . . . .	51	Discovery . . . . .	61, 62	# 8602x . . . . .	79
# 02-531 . . . . .	51	Embrace . . . . .	63	# 8603M . . . . .	79
# 02-533 . . . . .	51	First Choice . . . . .	64	# 8605x . . . . .	79
# 02-537 . . . . .	51	On My Way . . . . .	65	# 8607x . . . . .	79
# 02-555 . . . . .	51	On My Way base . . . . .	66	# 8608D . . . . .	79
# 22-625 xxx GB1B . . . . .	58	Tribute . . . . .	67	# 8609x . . . . .	80
# 22630xxx . . . . .	54, 55	Triumph . . . . .	68, 69	# 8616x . . . . .	80
# 22631xxx . . . . .	54, 55	<b>Fisher Price</b>		# 8629x . . . . .	75
# 22740 . . . . .	59	ALL MODELS . . . . .	70	# 8630x . . . . .	75
# 22750 . . . . .	53	<b>Ford [Aftermarket]</b>		# 8631x . . . . .	75
# 22755 . . . . .	53	ALL MODELS . . . . .	71	# 8632x . . . . .	75
# 22756 . . . . .	53			# 8635x . . . . .	75
# 22757 . . . . .	53			# 8639x . . . . .	75
# 22770 . . . . .	53				
3-in-1 . . . . .	51, 52				

<b>Graco (continued)</b>		# 61FG53ST49	91	# 22460	109
# 8643x	80	# 61FG53ST64	91	# 22480	108
# 8645x	80	# 61ST13IC53	91	# 22481	108
# 8646x	80	# 61ST34IC53	91	Alpha Elite	103
# 8686x	74	# 61ST48IC53	91	Alpha Omega	104
# 8689x	74	# AL33USL	90	Alpha Omega Elite	104
# 8C00x	75	# AL33USN	90	Alpha Sport	105
# 8C01x	75	# AL34USL	90	Designer 22	106, 107
# 8C02MRC2	76	# AL34USN	90	Enspira	108
# 8C02x	75	# CS00MU1	89, 90, 91	Intera	109
# 8C03x	75	# CS00US1	89, 90		
# 8C04FRR	77	# CS00US8	89, 90	<b>Snug Seat</b>	
# 8C04FRR2	77	# IMCB00JA57RJ31JU31	88	# 200-1000	110
# 8C04x	75	# LN34S09	90	# 600-1000	111
# 8D01x	74	# LN34S10	90	# E9L32	112
# 8D02x	74	# LV34USL	90	Gorilla	110
# 8D03x	74	# LV34USN	90	Spelcast	111
# 8D04x	74	# ST33USL	90	Traveller Plus	112
# 8D05x	74	# ST33USN	90		
# 8D10x	74	# ST38USL	90	<b>Strolee</b>	
# C844342	79	# ST38USN	90	ALL MODELS	113
CarGo	74	Jacadi	88		
ComfortSport	75, 76, 77	Primo Viaggio	89, 90	<b>Team-Tex</b>	
SnugRide	78, 79, 80	Primo Viaggio SIP 30/30	91	# 374099	114
				# 374199	115
<b>International</b>		<b>Playskool</b>		Babyride	114, 115
ALL MODELS	81	ALL MODELS	92		
		<b>Plymouth [Integrated]</b>		<b>Triple Play (see Safeline Kids also)</b>	
<b>Kolcraft</b>		Grand Voyager	128, 129, 130, 131	# 4002	116
ALL MODELS	82	Voyager	128, 129, 130, 131	Sit'n'Stroll	116
<b>Lin Lih/MCP</b>		<b>Pride Trimble/Virco</b>		<b>TRW</b>	
ALL MODELS	83	ALL MODELS	93	ALL MODELS	117
				<b>XSCi</b>	
<b>Maxi-Cosi</b>		<b>Questor</b>		Pioneered ACIS	118
# 22-371	84	ALL MODELS	94		
# 22-372	84				
# 22-515	84	<b>Recaro</b>			
Mico	84	# 330.00.xxx	99		
<b>Mercedes-Benz</b>		# 330.01.xxx	99		
# B66868203	85	# 331.00.xxx	95, 96, 97, 98		
# B66868204	85	# 331.01.xxx	97		
# B66868209	85	Como	95, 96, 97		
Kiddy TopSafe	85	Signo	98, 99		
		<b>Renolux (FBS)</b>			
<b>Mia Moda</b>		ALL MODELS	100		
# 5000	86, 87			<b>Safeline Kids (see Triple Play also)</b>	
# 5001	86, 87			# 2003	101
# 5050	87			# 2240	102
# 5051	87			Sit'n'Stroll	101, 102
# 5070	87				
# 5071	87	<b>Safety 1st (Dorel)</b>			
# 5080	87	# 02-620-xxx	106		
# 5081	87	# 02-621-SAL	106		
Viva	86, 87	# 22-325xxxGB1B	107		
Viva Supreme	87	# 22151	104		
		# 22450	108		
<b>Peg Perego</b>		# 22451	108		
# 32MD41KN41	91	# 22452	108		
# 35CR13BU13	91	# 22453	108		
# 35CR13PL46	91	# 22455	104		
# 35CR24BU24	91				
# 35TL49KN53	91				
# 35TL53KN46	91				
# 61FG13ST53	91				

List #	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer Assistance	Mfg Date Problem Type and Consumer Action
1)	<b>Alcot (Childcare)</b>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
2)	<b>All Our Kids</b>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Alpha Elite (Dorel)</b>		<b>Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141</b> <b>www.djgusa.com</b>	
3)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
4)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
5)	<b>American Motors</b>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Baby Trend</b>		<b>800-328-7363 - www.babytrend.com</b>	
6)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
7)	Rigid Latch-Loc Base	6400	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
8)	<b>Babyhood Industries</b>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
9)	<b>Basic Comfort</b>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Beatrix Potter (Dorel)</b>		<b>Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141</b> <b>www.djgusa.com</b>	
10)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02- 02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
11)	<b>Bolform Corp.</b>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Britax</b>		<b>888-427-4829 / 704-409-1700 - www.britaxusa.com</b>	
12)	Advantage	E902228	03/05/01- 07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
13)	Boulevard	E9L57	03/01/06- 08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
14)	Companion	E9L14	10/31/03- 06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

**Britax (continued)**

15)	Companion	E9L14, E9L20, E9L80	Pre-11/01/07	User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels
16)	Companion	E9L14, E9L20, E9L80	All	Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
17)	Decathlon	E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
18)	Frontier	E9L54E7, E9L54H6, E9L54H7, E9L54M6	04/01/08-09/14/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
19)	Frontier	E9L5490	04/01/08-09/17/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
20)	Husky	E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
21)	Husky	E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
22)	Marathon	E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
23)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06-07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
24)	Regent Classic	E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
25)	Regent	E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
26)	Super Elite	E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
27)	Super Elite	E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
28)	Traveller Plus	E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
29)	Wizard	E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.

**Century Products****800-837-4044 / 216-468-2000 - [www.gracobaby.com](http://www.gracobaby.com)**

30)	Accel	45100, 45200, 45600, 45700	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
31)	Bravo	44622, 44630, 44631, 44662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
32)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

**Century (continued)**

- 33) Smart Move 44709 04/09/01-05/10/01 Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

**Chicco****800-807-8817 / 877-424-4226 - [www.chiccousa.com](http://www.chiccousa.com)**

- 34) Key Fit All 02/26/08-03/17/08 Recall applies only to bases manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained.

- 35) **Chrysler** REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

- 36) **Collier-Keyworth** REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

**Combi USA****800-992-6624 / 803-548-6633 - [www.combi-intl.com](http://www.combi-intl.com)**

- 37) Avatar 8100 11/12/03-05/07/04 Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
- 38) Centre ST 8065 10/19/05-12/15/07 The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg. for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
- 39) Shuttle 8087 10/19/05-12/15/07 The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg. for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.

**Compass Baby****888-899-2229 - [www.compassbaby.com](http://www.compassbaby.com)**

- 40) Infant Car Seat I420 ARD 05/07/06, I420 FUO 05/13/06, I420 MAR 05/15/06 The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit.

**Cosco (Dorel)****Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 [www.djgusa.com](http://www.djgusa.com)**

- 41) Alpha Omega 02-331, 02-332, 02-531, 02-533, 02-537, 02-555. 11/17/00-01/10/01 Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
- 42) Alpha Omega 22150, 22180, 22269 11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
- 43) Arriva 02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774 03/01/95-01/31/00 Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>

**Cosco (continued)**

44)	Designer 22 22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
45)	DreamRide 22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
46)	High Rise Booster 22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
47)	Regal Ride 22139MON	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
48)	Touriva 22100x, 22111x, 22130x, 93100x, 93111x	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
49)	Turnabout 02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]

50) **Downunder**

**REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

**Eddie Bauer (Dorel)**

**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141  
www.djgusa.com**

51)	3-in-1 02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
52)	3-in-1 All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
53)	Alpha Omega 22750 Alpha Omega 22755, 22756, 22757, Elite 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
54)	Comfort Infant Seat 22630xxx, 22631xxx	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
55)	Comfort Infant Seat 22630xxx, 22631xxx	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
56)	Deluxe 3-in-1 All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
57)	Deluxe Convertible All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
58)	Designer 22 22-625 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.

List #	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer Assistance Mfg Date	Problem Type and Consumer Action
--------	-------------------------	--	---------------------------------	----------------------------------

**Eddie Bauer (continued)**

59) Enspira 22740 11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

**Evenflo****800-525-2472 / 800-233-5921 / 800-490-7497 - www.evenflo.com**

60) Cozy Carry 272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x ALL (11/01/01-08/31/02) Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.

61) Discovery 390, 391, 534, 552 Pre-02/01/08 Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.

62) Discovery 3021769Z, 3021854Z 02/04/08 A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.

63) Embrace Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599 Pre-04/08/06 When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.

>>64) First Choice 3604098 01/16/09-09/29/09 A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.

65) On My Way Begins with 200, 211, 447, 499 Pre-02/10/00 Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.

66) On My Way base 639001, 639002 Pre-02/10/00 Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.

67) Tribute 378x, 379x 09/08/05-09/22/05 Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.

68) Triumph 264x, 359x, 389x 09/06/01-10/31/05 Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.

69) Triumph 264x 10/20/01-01/31/02 Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.

70) **Fisher Price****REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS**71) **Ford****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**72) **General Motors****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**73) **Gerry****REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS****Graco****800-345-4109 - www.gracobaby.com**

74) CarGo 8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x 01/09/07-03/03/08 An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date Problem Type and Consumer Action</i>

**Graco (continued)**

- |     |   |                       |  |
|-----|---|-----------------------|--|
| 75) | ComfortSport<br>8629x, 8630x, 8631x,<br>8632x, 8635x, 8639x,<br>8C00x, 8C01x, 8C02x,<br>8C03x, 8C04x, 8433x   | 01/02/07-<br>07/31/07 | Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.   |
| 76) | ComfortSport<br>8C02MRC2  | 10/22/07              | Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.  |
| 77) | ComfortSport<br>8C04FRR, 8C04FRR2   | 11/01/06-<br>10/08/07 | Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.   |
| 78) | SnugRide #'s 7493, 7497, 7499, 841101,<br>841102, 841103, 841203, 8412T02, 8457,<br>8458, 8459, 8460, 8462, 8471, 8472, 8473,<br>8474, 8476, 8477, 8478 <i>See Note</i>   | 08/31/99-02/28/02     | May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters. |
| 79) | SnugRide #'s 8402, 8402L, 8403x,<br>8412, 8442x, 8443, 8443L, 8444, 8444L,<br>8446, 8446L, 8447, 8447L, 8448, 8448L,<br>8457, 8458, 8459, 8463x, 8464, 8470, 8471,<br>8478, 8601, 8602x, 8603M, 8605x, 8607x,<br>8608D, C844342 | 03/01/02-03/08/03     | May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]   |
| 80) | SnugRide<br>8609x, 8616x, 8643x,<br>8645x, 8646x  | 08/01/06-<br>06/30/07 | The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.  |

81) **International** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

82) **Kolcraft** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

83) **Lin Lih/MCP Ent.** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

**Maxi-Cosi (Dorel)**

**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141**  
**www.djgusa.com**

- |     |                     |                          |                       |  |
|-----|---------------------|--------------------------|-----------------------|--|
| 84) | Mico<br>Mico (base) | 22-371, 22-372<br>22-515 | 07/01/07-<br>02/17/08 | Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base. |
|-----|---------------------|--------------------------|-----------------------|--|

**Mercedes-Benz USA**

**800-367-6372 - www.mbusa.com**

- |     |  |                                     |                       |  |
|-----|--|-------------------------------------|-----------------------|--|
| 85) | Kiddy TopSafe<br>(mfg. by<br>Sicartex) | B66868203<br>B66868204<br>B66868209 | 03/01/03-<br>11/30/03 | Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information. |
|-----|--|-------------------------------------|-----------------------|--|

**Mia Moda**

**866-642-6632 - www.miamodainc.com**

- |     |      |                          |                       |  |
|-----|------|--------------------------|-----------------------|--|
| 86) | Viva | 5000 (seat), 5001 (base) | 12/19/06-<br>02/06/07 | The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg. |
|-----|------|--------------------------|-----------------------|--|

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b>Mia Moda (continued)</b>				
>>87)	Viva 5000 (seat), 5001 (base), 5050 (seat), 5051 (base), 5070 (seat), 5071 (base)		12/01/06-05/31/09	Sharp edges on the harness splitter plate can cut the harness. Also, the base could crack in a crash. Contact mfg. at 877-546-8437 for a full refund. <u>Mia Moda is urging parents/caregivers to discontinue use of the seat until it can be replaced.</u> According to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking.
	Viva Supreme 5080 (seat), 5081 (base)			
<hr/>				
<b>Peg Perego USA</b>		<b>877-737-3468 / 219-482-8191 - www.perego.com</b>		
88)	Jacadi IMCB00JA57RJ31JU31		07/01/07-03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit.
89)	Primo Viaggio CS00MU1, CS00US1, CS00US8		02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
90)	Primo Viaggio CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL		05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg. for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
91)	Primo Viaggio SIP 30/30 32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61FG13ST53, 61FG53ST49, 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53		07/01/07-03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. Note: Affected model numbers begin with IMUN00US.
<hr/>				
92)	<b>Playskool</b>	<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
<hr/>				
93)	<b>Pride Trimble/Virco</b>	<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
<hr/>				
94)	<b>Questor</b>	<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
<hr/>				
<b>Recaro</b>		<b>800-873-2276 / 248-364-3818 - www.recaro-nao.com</b>		
95)	Como 331.00.xxx		Pre-09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
96)	Como 331.00.xxx		Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
97)	Como 331.00.xxx, 331.01.xxx		11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.
98)	Signo 331.00.xxx		Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>#</i>	<i>Model Name</i>	<i>Mfg Date Problem Type and Consumer Action</i>

**Recaro (continued)**

99)	Signo	330.00.xxx, 330.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.
-----	-------	------------------------	-------------------	---

100) **Renolux (FBS)**

*REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

**Safeline Kids  
(See Triple Play Products also)**

**800-829-1625 - [www.tripleplayproducts.com](http://www.tripleplayproducts.com)**

101)	Sit'n'Stroll	2003	09/01/02-10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.
102)	Sit'n'Stroll	2240	04/01/01-10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.

**Safety 1<sup>st</sup> (Dorel)**

**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141  
[www.djgusa.com](http://www.djgusa.com)**

103)	Alpha Elite	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
104)	Alpha Omega Alpha Omega Elite	22151 22455	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
105)	Alpha Sport	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
106)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
107)	Designer 22	22-325 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
108)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
109)	Intera	22460	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

**Snug Seat**

**800-336-7684 - [www.snugseat.com](http://www.snugseat.com)**

110)	Gorilla	200-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
111)	Spelcast	600-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
112)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact Britax at 800-683-2045 or 704-409-1700 for repair kit.

113) **Strolee**

*REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Model #</i>	<i>Mfg Date Problem Type and Consumer Action</i>

**Team-Tex America****877-912-1313**

114) Babyride 374099

08/31/06-10/23/06 Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.

115) Babyride 374199

12/18/08 The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.

**TriplePlay Products  
(See Safeline Kids also)****800-829-1625 - [www.tripleplayproducts.com](http://www.tripleplayproducts.com)**

116) Sit'n'Stroll 4002

05/05/08 The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.

117) **TRW****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****XSCi****800-630-6850 / 719-593-8881**

118) Pioneered ACIS None\*

02/01/02-03/07/02 Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) \*No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024]  
\*\*NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.\*\*

*Integrated (built-into the vehicle) seats*

	<i>Manufacturer</i>	<i>Model Year</i>	<i>Customer Assistance</i>
	<b><i>Chrysler</i></b>		<b><i>800-853-1403 / 800-992-1997</i></b>
119)	Town and Country	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
120)	Town and Country	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
121)	Town and Country	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
122)	Town and Country	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
	<b><i>Dodge</i></b>		<b><i>800-853-1403 / 800-992-1997</i></b>
123)	Caravan Grand Caravan	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
124)	Caravan Grand Caravan	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
125)	Caravan Grand Caravan	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
126)	Caravan Grand Caravan	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
	<b><i>Ford</i></b>		<b><i>800-392-3673</i></b>
127)	Windstar	1998	The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.
	<b><i>Plymouth</i></b>		<b><i>800-853-1403 / 800-992-1997</i></b>
128)	Voyager Grand Voyager	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
129)	Voyager Grand Voyager	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
130)	Voyager Grand Voyager	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
131)	Voyager Grand Voyager	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.

Child restraints (CRs) manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of October 29, 2009.** Updated versions of this list and a listing of recalls on models less than 10 years old are posted on-line at [www.hsrb.unc.edu](http://www.hsrb.unc.edu).

## CHILD RESTRAINTS AT LEAST 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names. **Note:** Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

<b>Alcot (Childcare)</b>	# 11-600	229, 230	# 4500	247
Child Love Seat	# 11-650	229	# 4510	247
	# 12-565	246	# 4513	246
<b>All Our Kids</b>	# 4100	212, 213	# 4515	246
# 600	# 4153	214	# 4516	246
# 602	# 4163	214	# 4518	246
Little Cargo Vest	# 4180	214	# 4520	247
	# 4200	215, 216, 217, 218	# 4525	248
<b>American Motors</b>	# 4210	215, 216, 217, 218	# 4535	245
Child Love Seat	# 4214	215, 216, 217, 218	# 4551	246
Infant Love Seat	# 4223	215, 216, 217, 218	# 4557	246
	# 4235	215, 216, 217, 218	# 4558	246
<b>Babyhood Industries</b>	# 4253	219, 220, 221	# 4559	246
# 810	# 4261	220, 221	# 4560	245
# 8200	# 4263	219, 220, 221	# 4564	246
Baby-Sitter	# 4265	219, 220, 221	# 4565	245, 246
Wonda Chair	# 4266	220, 221	# 4566	246
	# 4300	222	# 4568	246
<b>Basic Comfort</b>	# 4302	222	# 4569	246
# 960	# 4303	222	# 4575	241, 246
# 961	# 4310	222	# 4576	246
Galaxy 2000	# 4323	222	# 4580	240
	# 4334	222	# 4581	239, 240
<b>Bolform Corp.</b>	# 4335	222	# 4583	239, 240
# 84E-019	# 4353	224, 225, 227	# 4585	239, 240
Buckle-Up Harness	# 4365	224, 225, 226, 227	# 4589	246
	# 4365DT	223	# 4590	245
<b>Britax</b>	# 4366	223, 224, 225, 226, 227	# 4591	246
# 101	# 4367	226, 227	# 4593	246
# 161	# 4368	224, 225, 226, 227	# 4594	246
Freeway	# 4369	226, 227	# 4595	246
Roundabout	# 4380	226, 228	# 4597	246
	# 4381	226	# 4600	244
<b>Century</b>	# 4400	231, 232	# 4750	249
# 11-564	# 4434	231, 232	# 4875	242
# 11-565	# 4436	231, 232	# 4885	243
# 11-570	# 4446	231, 232	100	212, 213
# 11-575	# 4450	233, 234, 236, 237	1000 STE	214
# 11-576	# 4460	233, 234, 235, 236, 237	200	215, 216, 217, 218
# 11-578	# 4470	234, 235, 236, 237	2000 STE	219, 220, 221
# 11-595	# 4475	233, 234, 235, 236, 237	300	222
# 11-597	# 4476	235, 236	3000 STE	223, 224, 225, 226, 227
# 11-598	# 4480	235, 238	3500 STE	228
# 11-599	# 4490	235, 238	4-In-1	229, 230

*Century (continued)*

400XL	231, 232
5000 STE	233, 234, 235, 236, 237
5500 STE	238
580	239, 240
Affinity	241
Breverra Contour	242
Breverra Premiere	243
Child Love Seat	244
Infant Car Seat	245, 246
Infant Love seat	247
Smart Fit	248
Smart Move	249

**Chrysler**

Child Love Seat	250
-----------------	-----

**Collier-Keyworth**

Co-Pilot	251
Commuter	253
Safe and Sound II	252

**Cosco (Dorel)**

# 02-014-EMF	268
# 02-014-GDM	268
# 02-015-PDL	268
# 02-084	267, 270
# 02-086	256
# 02-090	264
# 02-094	270
# 02-096	270
# 02-190	266
# 02-290	265
# 02-404	270
# 02-514-BWE	269
# 02-518-NDF	269
# 02-584-OXF	269
# 02-719 ARQ	257
# 02-729 TED	255
# 02-751	254
# 02-790	258
# 02-821	270
# 02-890	258
# 181A	259
# 181B	259
# 313	261
# 323	262
# 423	262
# 81A	259
# 81B	259
Arriva	254, 255
Commuter	256
Dream Ride	257
Lxry Sft Shld Auto Trac	258
Safe and Easy	261
Safe and Snug	262
Safe-T Mate	260
Safe-T-Shield	259
Sft Shld Auto Trac	265
Soft Shield	264
Soft Shield Deluxe	266
Touriva	267, 268, 269, 270

Voyager Inf/Stroller	272
----------------------	-----

**Dorel**

# 02-014-EMF (Cosco)	268
# 02-014-GDM (Cosco)	268
# 02-015-PDL (Cosco)	268
# 02-084 (Cosco)	267, 270
# 02-086 (Cosco)	256
# 02-090 (Cosco)	264, 265
# 02-094 (Cosco)	270
# 02-096 (Cosco)	270
# 02-190 (Cosco)	266
# 02-404 (Cosco)	270
# 02-514-BWE (Cosco)	269
# 02-518-NDF (Cosco)	269
# 02-584-OXF (Cosco)	269
# 02-719 ARQ (Cosco)	257
# 02-729 TED (Cosco)	255
# 02-751 (Cosco)	254
# 02-790 (Cosco)	258
# 02-821 (Cosco)	270
# 02-890 (Cosco)	258
# 181A (Cosco)	259
# 181B (Cosco)	259
# 219x (Cosco)	271
# 224x (Cosco)	271
# 225x (Cosco)	271
# 229x (Cosco)	271
# 244x (Cosco)	263
# 313 (Cosco)	261
# 323 (Cosco)	262
# 423 (Cosco)	262
# 81A (Cosco)	259
# 81B (Cosco)	259
Arriva (Cosco)	254, 255
Commuter (Cosco)	256
Dream Ride (Cosco)	257
Lxry Sft Shld Auto Trac (Cosco)	258
Safe and Easy (Cosco)	261
Safe and Snug (Cosco)	262
Safe-T-Mate (Cosco)	260
Safe-T-Shield (Cosco)	259
Sft Shld Auto Trac (Cosco)	265
Sidekick Booster (Cosco)	263
Soft Shield (Cosco)	264
Soft Shield Deluxe (Cosco)	266
Touriva (Cosco)	267
Touriva 5-point (Cosco)	269
Touriva Shield (Cosco)	268
Touriva T-Shield (Cosco)	270
Trooper (Cosco)	271
Voyager Inf/Stroller (Cosco)	272

**Downunder**

Kangaroo Booster	273
------------------	-----

**Evenflo**

# 201	285
# 202	283, 285
# 203x	286
# 205x	286, 295, 296
# 206	287

# 207x	288
# 210x	286, 296
# 219164	297
# 219180	297
# 219186	297
# 219188	297
# 21940	297
# 219x	271, 281, 292
# 221	289
# 222	290
# 223	290
# 224x	271, 279, 280, 281, 292
# 225x	271, 281, 292
# 227	301
# 228	294
# 229x	271, 281, 291, 292
# 231	300
# 232	302
# 242	278
# 244x	263
# 401	289
# 402	289
# 403	289
# 404	289
# 405	289
# 406	289
# 407	289
# 408	289
# 409	289
# 410	274
# 411	275
# 412	276
# 414	276
# 415	276
# 416	276
# 4176	290
# 420	299
# 435x	286
# 441	282, 283, 285
# 442	282, 283, 285
# 443	282, 283, 285
# 444	282, 283, 285
# 445	282, 283, 285
# 446	282, 283, 285
# 447	282, 283
# 448	282, 283, 285
# 453	293, 294
# 454	293, 294
# 456	284, 285
# 458	284, 285
# 470	277, 278
# 471	277, 278
# 492x	288
# 493x	286
# 636x	298
# 637x	298
410	274
Bobby Mac Champion	275
Bobby Mac Deluxe	276
Booster Seat	277, 278
Champion	279, 280, 281
Dyn-O-Mite	282, 283

**Evenflo (continued)**

Infant Car Seat . . . . . 284, 285  
 Joyride . . . . . 286  
 On My Way . . . . . 287, 288  
 One-Step . . . . . 289  
 One-Step Deluxe . . . . . 290  
 Scout . . . . . 291, 292  
 Seven Year Seat . . . . . 293, 294  
 Sidekick . . . . . 263  
 Travel Tandem . . . . . 295, 296  
 Trooper . . . . . 271, 297  
 Two-in-One . . . . . 298  
 Ultara 1 . . . . . 299, 300  
 Ultara II . . . . . 301, 302

**Fisher Price**

# 79700 . . . . . 317  
 # 9100 . . . . . 303, 304, 305, 306, 307, 308, 309, 310, 311  
 # 9101 . . . . . 304, 305, 307, 308, 309, 310, 311  
 # 9104 . . . . . 312, 315, 316  
 # 9149 . . . . . 313  
 # 9173 . . . . . 314  
 Booster . . . . . 315, 316  
 Car Seat . . . . . 303, 304, 305, 306, 307, 308, 309, 310, 311  
 Delux Car Seat . . . . . 312  
 Infant Seat . . . . . 313, 314  
 Safe Embrace . . . . . 317

**Ford**

Infant Love Seat . . . . . 318

**General Motors**

Child Love Seat . . . . . 320  
 Infant Love Seat . . . . . 319

**Gerry**

# 626 . . . . . 322  
 Guardian . . . . . 321  
 Secure Ride . . . . . 322

**Graco**

GT 1000 . . . . . 323

**International**

Astroseat . . . . . 324

**Kolcraft**

# 131-101 . . . . . 350  
 # 13123 . . . . . 349  
 # 1312x . . . . . 333  
 # 1382x . . . . . 333, 345, 348, 355  
 # 13833 . . . . . 326, 347, 354  
 # 1383x . . . . . 330, 333, 345, 348, 355  
 # 13842 . . . . . 326, 347, 354  
 # 1384x . . . . . 345, 348, 355  
 # 13852 . . . . . 326, 347, 354  
 # 1385x . . . . . 348, 355  
 # 138xx . . . . . 332, 344, 346, 353  
 # 140-155 . . . . . 341  
 # 150-100 . . . . . 357

# 180-100 . . . . . 336  
 # 180-150 . . . . . 336, 337  
 # 180-200 . . . . . 327, 328, 337, 338  
 # 180-300 . . . . . 327, 328  
 # 180-400 . . . . . 341  
 # 180-600 . . . . . 325, 329  
 # 180-601 . . . . . 325  
 # 19127 . . . . . 334, 335  
 # 19128 . . . . . 334  
 # 19129 . . . . . 334  
 # 19130 . . . . . 334  
 # 368xx . . . . . 332, 333, 344, 345, 346, 348, 353  
 # 43xxx . . . . . 331, 351  
 # 77001 . . . . . 342  
 # 77002 . . . . . 342  
 # 77005 . . . . . 343  
 # 77007 . . . . . 343  
 Automate . . . . . 325  
 Carter Travel 5 . . . . . 326  
 Dial-A-Fit . . . . . 327, 328  
 Dial-A-Fit II . . . . . 329  
 Flip 'N' Go . . . . . 334  
 Flip 'N' Go II . . . . . 335  
 Infant Car Seat . . . . . 330  
 Infant Restraint . . . . . 331  
 Infant Rider . . . . . 332, 333  
 Perfect Fitt . . . . . 336, 337, 338  
 Performa . . . . . 339, 340  
 Playskool . . . . . 341, 342  
 Playskool Infant . . . . . 343  
 Plus 4 . . . . . 344, 345  
 Plus 5 . . . . . 346, 347, 348  
 Rock 'N' Ride . . . . . 349, 350  
 Secura . . . . . 351  
 Secure Fit . . . . . 352  
 Travel About . . . . . 353, 354  
 Travel-About . . . . . 355  
 Traveler 700 . . . . . 356, 357, 358

**Lin Lih/MCP**

# 180-200 . . . . . 360  
 # 180-300 . . . . . 360  
 Lin Lih . . . . . 359, 360

**Mercedes-Benz**

# BQ6910155 . . . . . 362  
 # BQ6910157 . . . . . 361  
 # BQ691063 . . . . . 361  
 Booster Seat . . . . . 361  
 Infant Restraint . . . . . 362

**Playskool**

# 140-155 . . . . . 363  
 # 180-400 . . . . . 363  
 # 77001 . . . . . 364  
 # 77002 . . . . . 364  
 # 77005 . . . . . 365  
 # 77007 . . . . . 365  
 Car Seat . . . . . 363, 364  
 Infant Car Seat . . . . . 365

**Pride Trimble/Virco**

# 832 . . . . . 368  
 # 890 . . . . . 366, 367  
 # 891 . . . . . 366, 367  
 # 892 . . . . . 366, 367  
 Click-n-Go . . . . . 366, 367  
 Pride Ride . . . . . 368

**Questor**

Kantwet Car Seat . . . . . 369

**Renolux (FBS)**

GT 1000 . . . . . 370  
 GT 2000 . . . . . 371, 372, 373  
 GT 4000 . . . . . 374, 375  
 GT 5000 . . . . . 376, 377  
 GT 5000 Turn A Tot . . . . . 378, 379, 380  
 GT 5500 . . . . . 381, 382  
 GT 7000 . . . . . 383, 384, 385

**Safeline Kids**

# 3240 . . . . . 386  
 Sit'n'Stroll . . . . . 386

**Safeline Kids (see Triple Play also)**

# 3240 . . . . . 387  
 Sit'n'Stroll . . . . . 387

**Strolee**

# 599 . . . . . 389  
 # 605 . . . . . 391  
 # 609 . . . . . 390  
 # 610 . . . . . 390  
 GT 3000 . . . . . 392  
 Quick Click . . . . . 391  
 Wee Care . . . . . 388, 389, 390

**TRW**

Child Love Seat . . . . . 394  
 Infant Love Seat . . . . . 393

**Volvo**

All . . . . . 395

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action
<b>Alcot (Childcare)</b>		<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
200)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b>All Our Kids</b>		<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
201)	Little Cargo Vest 600		4/93-3/94	Flammability of upholstery. Call mfg. for repair info.
202)	Little Cargo Vest 602		3/94-9/94	Flammability of upholstery. Call mfg. for repair info.
<b>American Motors</b>		<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
203)	Infant Love Seat All		1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
204)	Child Love Seat All		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b>Babyhood Industries</b>		<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
205)	Wonda Chair 810		Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
206)	Baby-Sitter 8200		1/92-6/93	Buckle. Call mfg. for repair info.
<b>Basic Comfort</b>		<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>		
207)	Galaxy 2000 960, 961		ALL	Crash test failure. Call mfg. for repair info.
208)	Galaxy 2000 960, 961		11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
<b>Bolform Corp.</b>		<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>		
209)	Buckle-Up Harness 84E-019		ALL	Crash test failure. Destroy & replace.
<b>Britax</b>		<b>888-427-4829 / 704-409-1700 www.britaxusa.com</b>		
210)	Freeway 101		6/96-4/97	Buckle. Call mfg. for repair info.
211)	Roundabout 161		1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
<b>Century Products</b>		<b>800-837-4044 / 216-468-2000</b>		
212)	100 4100		1/81-4/81	Upholstery buttons. Call mfg. for repair info.
213)	100 4100		4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
214)	1000 STE 4153, 4163, 4180		12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
215)	200 4200, 4210, 4235, 4214, 4223		1/81-4/81	Upholstery buttons. Call mfg. for repair info.
216)	200 4200, 4210, 4235, 4214, 4223		June 81	Washers on frame. Call mfg. for repair info.
217)	200 4200, 4210, 4235, 4214, 4223		1/81-1/83	Buckle. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Century Products (continued)</i>				
218)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
219)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
220)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
221)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
222)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
223)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
224)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
225)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
226)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
227)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
228)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
229)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
230)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
231)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
232)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
233)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
234)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
235)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
236)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
237)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
238)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
239)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
240)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
241)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
242)	Breverra Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
243)	Breverra Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
244)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
245)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Century Products (continued)**

246)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
247)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
248)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
249)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.

**Chrysler****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

250)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	-----------------	-----	------------	---

**Collier-Keyworth****800-544-1108**

251)	Co-Pilot	All	82-83	Shield. Call mfg. for repair info.
252)	Safe and Sound II	All	12/84-4/85	Buckle. Call mfg. for repair info.
253)	Commuter	All	10/87-02/88	Padding. Call mfg. for repair info.

**Cosco (Dorel)****Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141**

254)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
255)	Arriva	02-729 TED	03/31/99- 04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
256)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
257)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
258)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
259)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
260)	Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
261)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
262)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
263)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
264)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
265)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
266)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
267)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
268)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

***Cosco (continued)***

269)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
270)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
271)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
272)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

***Downunder***

273) Kangaroo  
Booster Seat All (Pre- 1/98)

***No longer in business***

Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.

***Evenflo******800-525-2472 / 800-233-5921***

274)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
275)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
276)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
277)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
278)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
279)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
280)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
281)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
282)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
283)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
284)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.
285)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
286)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
287)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.
288)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
289)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
290)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
291)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
292)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
293)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Evenflo (continued)**

294)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
295)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
296)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
297)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
298)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
299)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
300)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
301)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
302)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

**Fisher Price****ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE**

303)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
304)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
305)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
306)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
307)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
308)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
309)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
310)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
311)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
312)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
313)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
314)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
315)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
316)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
317)	Safe Embrace	79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.

**Ford****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

318)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	------------------	-----	-------	---

**General Motors****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

319)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
320)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b>Gerry</b>			<b>Contact Evenflo: 800-525-2472 / 800-233-5921</b>	
321)	Guardian	All	01/90-05/90	Buckle. Call mfg. for repair info.
322)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label
<b>Graco</b>			<b>800-345-4109 / www.gracobaby.com</b>	
323)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
<b>International</b>			<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>	
324)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
<b>Kolcraft</b>			<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>	
325)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
326)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
327)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
328)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
329)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
330)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
331)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
332)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
333)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
334)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
335)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
336)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
337)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
338)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
339)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
340)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
341)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
342)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
343)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
344)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
345)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
346)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
347)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
348)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-----------------	---

**Kolcraft (continued)**

349)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
350)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
351)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
352)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
353)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
354)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
355)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
356)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
357)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
358)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

**Lin Lih/MCP Ent.****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

359)	Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
360)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

**Mercedes-Benz USA****800-367-6372 - www.mbusa.com**

361)	Booster	BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
362)	Infant Restraint	BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.

**Playskool****Contact Kolcraft: 800-453-7673**

363)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
364)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft
365)	Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.

**Pride Trimble/Virco****800-521-5198**

366)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
367)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
368)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.

**Questor****Contact Evenflo: 800-233-5921**

369)	Kantwet Car Seat	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
------	------------------	-----	-----------	---

**Renolux (FBS)****ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

370)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
371)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
372)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Renolux (continued)**

373)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.
374)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
375)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
376)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
377)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
378)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
379)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
380)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
381)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
382)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
383)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
384)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
385)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

**Safeline Kids**

**800-829-1625**  
**[www.tripleplayproducts.com](http://www.tripleplayproducts.com)**

386)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
387)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.

**Strolee**

**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

388)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
389)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
390)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
391)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
392)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.

**TRW**

**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

393)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
394)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

**Volvo**

**800-458-1552 / 800-221-9136 / 201-768-7300**

395)	ALL SEATS	All	Thru 12/88	Buckle. Call mfg. for refund info.
------	-----------	-----	------------	------------------------------------