

USING THE HIGHWAY SAFETY RESEARCH CENTER CHILD RESTRAINT RECALL LIST

Last Revisions – Newer Model List: May 29, 2009
Older Model List: May 29, 2009

About Child Restraints and Recalls

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Many recalls are issued due to reasons related to the crashworthiness of the child restraint, but some recalls are for deviations from the standards relating to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Child restraints (CRs) are required to have a label indicating the manufacturer, model information, and date of manufacture. If the label is missing on a child restraint, the manufacturer should be contacted to see if the CR can be identified through other information. CRs should not be used if the model name, number, and date of manufacture cannot be determined.

Child restraint manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost or if it was made before 1993, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the restraints unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current restraint or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected child restraint or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236.

About Older Child Restraints and Recalls

Child restraints manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years and some child restraints are stamped with an expiration date. Parents and other caregivers are encouraged to contact the child restraint manufacturer for model specific recommendations.

Older models, those manufactured since 1981, are included as a part of the HSRC recall list because parents and other care givers will sometimes choose to use child restraints older than ten years even

though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect can be corrected, should help to encourage the care giver to destroy the older CR and obtain a new one.

About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) child restraint (CR) recall list identifies recalls and safety notifications for child restraint systems known by the HSRC at the time it is published and is updated by HSRC as soon as possible after recall notifications are announced. To be notified via email whenever the HSRC Recall List is updated, go to <http://www.hsrc.unc.edu/recalls> and click on the link to "Sign up for automatic email notification of updates to the HSRC recall list."

The HSRC recall list is formatted in a relatively compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this list are encouraged to obtain more detailed information about recent recalls through the "Most Recent Car Seat Recall Announcements and Notices" page of the HSRC Recall List website.

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of child restraints where most or all of the effected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised.

Instructions for Using the PDF Version of the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the child restraint itself. Using this information:

- Look to see if the manufacturer and model name and/or model number are listed in the index. NOTE: Child restraints under recall are listed in the index by both model name and model number. Each entry on the list and in the index is assigned a "List #" based on its location in the list alphabetized by manufacturer and model name. List #'s for individual models will change in subsequent lists as models are added to or removed from the list.
- If that model name or model number is listed in the index, note the "List # (number)" and use the List # to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the child restraint.
- If the restraint is included in the recall, the CR manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
- If the manufacturer has gone out of business or discontinued their repair or replacement program, the CR should be destroyed after a replacement restraint is obtained.
- If the restraint is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the restraint's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

For further information, contact:

Bill Hall
The University of North Carolina Highway Safety Research Center
CB# 3430
Chapel Hill, NC 27599
919-962-2202 or (in NC) 800-672-4527 or bill_hall@unc.edu

The following lists identify recalls and safety notifications for child restraints (CRs) known by the UNC Highway Safety Research Center (HSRC) as of May 29, 2009. This list is updated by HSRC as soon as possible after recall notifications are announced. Updated versions are available on-line at www.hsrc.unc.edu or by phone at 919-962-2202 or 800-672-4527 (in NC). The most recent addition(s) to the list is/are denoted by ">>".

CRs are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. Model numbers followed by one or more "x" should be read as "model numbers beginning with." If the label is missing on your CR, contact the manufacturer to see if it can be identified through other information. **A CR should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

CRs manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Models older than ten years and under recall are included on a separate list with a separate index.** The index for older models can be found following the last page of the "Models Less Than 10 Years Old" recall list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised May 29, 2009.**

Some of the recalls/notifications for CRs on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific CR is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current CR or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the CR and obtain and use another one as soon as possible. Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded CRs should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected safety seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236.

CHILD RESTRAINTS LESS THAN 10 YEARS OLD

Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names.

Alcot ALL MODELS 1	# 6439 6 # 6448 6 # 6481 6 Rigid Latch-Loc 6 Rigid Latch-Loc Base 7	Designer 22 10 Bolform ALL MODELS 11 Britax # E902228 12 # E9031 26, 27 # E906 23 # E9L06 23 # E9L07 29 # E9L14 14, 15, 16 # E9L20 15, 16 # E9L30 20, 21, 22 # E9L32 28 # E9L3998 24	# E9L39x 25 # E9L47 17 # E9L5490 19 # E9L54E7 18, 19 # E9L54H6 18 # E9L54H7 18 # E9L54M6 18 # E9L57 13 # E9L80 15, 16 # E9W06 23 Advantage 12 Boulevard 13 Companion 14, 15, 16 Decathlon 17 Frontier 18, 19 Husky 20, 21
All Our Kids ALL MODELS 2	Babyhood Industries ALL MODELS 8 Basic Comfort ALL MODELS 9 Beatrix Potter (Dorel) # 02-620-AZY 10 # 02-620-BEA 10 # 02-621-SAL 10		
Alpha Elite (Dorel) # 22331 BLA 3, 4 # 22332 RLA 3, 4 Comfort Infant Seat 3, 4			
American Motors ALL MODELS 5			
Baby Trend # 6400 7			

Graco (continued)

# 8458	77, 78
# 8459	77, 78
# 8460	77
# 8462	77
# 8463x	78
# 8464	78
# 8470	78
# 8471	77, 78
# 8472	77
# 8473	77
# 8474	77
# 8476	77
# 8477	77
# 8478	77, 78
# 8487x	73
# 8601	78
# 8602x	78
# 8603M	78
# 8605x	78
# 8607x	78
# 8608D	78
# 8609x	79
# 8616x	79
# 8629x	74
# 8630x	74
# 8631x	74
# 8632x	74
# 8635x	74
# 8639x	74
# 8643x	79
# 8645x	79
# 8646x	79
# 8686x	73
# 8689x	73
# 8C00x	74
# 8C01x	74
# 8C02MRC2	75
# 8C02x	74
# 8C03x	74
# 8C04FRR	76
# 8C04FRR2	76
# 8C04x	74
# 8D01x	73
# 8D02x	73
# 8D03x	73
# 8D04x	73
# 8D05x	73
# 8D10x	73
# C844342	78
CarGo	73
ComfortSport	74, 75, 76
SnugRide	77, 78, 79

International	
ALL MODELS	80

Kolcraft	
ALL MODELS	81

Lin Lih/MCP	
ALL MODELS	82

Mercedes-Benz	
# B66868203	83
# B66868204	83
# B66868209	83
Kiddy TopSafe	83

Mia Moda	
# 5000	84
# 5001	84
Viva	84

Peg Perego	
# 32MD41KN41	88
# 35CR13BU13	88
# 35CR13PL46	88
# 35CR24BU24	88
# 35TL49KN53	88
# 35TL53KN46	88
# 61FG13ST53	88
# 61FG53ST49	88
# 61FG53ST64	88
# 61ST13IC53	88
# 61ST34IC53	88
# 61ST48IC53	88
# AL33USL	87
# AL33USN	87
# AL34USL	87
# AL34USN	87
# CS00MU1	86, 87, 88
# CS00US1	86, 87
# CS00US8	86, 87
# IMCB00JA57RJ31JU31	85
# LN34S09	87
# LN34S10	87
# LV34USL	87
# LV34USN	87
# ST33USL	87
# ST33USN	87
# ST38USL	87
# ST38USN	87
Jacadi	85
Primo Viaggio	86, 87
Primo Viaggio SIP 30/30	88

Playskool	
# 77005	89
# 77007	89
Infant Car Seat	89

Plymouth [Integrated]	
Grand Voyager	125, 126, 127, 128
Voyager	125, 126, 127, 128

Pride Trimble/Virco	
ALL MODELS	90

Questor	
ALL MODELS	91

Recaro	
# 330.00.xxx	96
# 330.01.xxx	96
# 331.00.xxx	94
# 331.00.xxx	92, 93, 95
# 331.01.xxx	94
Como	92, 93, 94
Signo	95, 96

Renolux (FBS)	
ALL MODELS	97

Safeline Kids (see TriplePlay also)	
# 2003	98
# 2240	99
Sit'n'Stroll	98, 99

Safety 1st (Dorel)	
# 02-620-AZY	103
# 02-620-BEA	103
# 02-621-SAL	103
# 22-325 CMB GB1B	104
# 22-325 DTA GB1B	104
# 22-325 TST GB1B	104
# 22-325 VIN GB1B	104
# 22151	101
# 22450	105
# 22451	105
# 22452	105
# 22453	105
# 22455	101
# 22460	106
# 22480	105
# 22481	105
Alpha Elite	100
Alpha Omega	101
Alpha Omega Elite	101
Alpha Sport	102
Designer 22	103, 104
Enspira	105
Intera	106

Snug Seat	
# 200-1000	107
# 600-1000	108
# E9L32	109
Gorilla	107
Spelcast	108
Traveller Plus	109

Strolee	
ALL MODELS	110

Team-Tex	
# 374099	111
# 374199	112
Babyride	111, 112

TriplePlay (see Safeline Kids also)	
# 4002	113
Sit'n'Stroll	113

TRW	
ALL MODELS	114

XSCi	
Pioneered ACIS	115

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>	
	<i>Model Name</i>		<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
1)	Alcot (Childcare)			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
2)	All Our Kids			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
	Alpha Elite			Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com
3)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
4)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
5)	American Motors			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
	Baby Trend			800-328-7363 - www.babytrend.com
6)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
7)	Rigid Latch-Loc Base	6400	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
8)	Babyhood Industries			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
9)	Basic Comfort			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
	Beatrix Potter			Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com
10)	Designer 22	02-621-SAL, 02-620-AZY, 02-620-BEA	01/03/02- 02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
11)	Bolform Corp.			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
	Britax			888-427-4829 / 704-409-1700 - www.britaxusa.com
12)	Advantage	E902228	03/05/01- 07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
13)	Boulevard	E9L57	03/01/06- 08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>

Britax (continued)

14)	Companion E9L14	10/31/03-06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.
15)	Companion E9L14, E9L20, E9L80	Pre-11/01/07	User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels
16)	Companion E9L14, E9L20, E9L80	All	Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
17)	Decathlon E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
18)	Frontier E9L54E7, E9L54H6, E9L54H7, E9L54M6	04/01/08-09/14/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
19)	Frontier E9L5490	04/01/08-09/17/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
20)	Husky E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
21)	Husky E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
22)	Marathon E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
23)	Marathon E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06-07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
24)	Regent Classic E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
25)	Regent E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
26)	Super Elite E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
27)	Super Elite E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
28)	Traveller Plus E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
29)	Wizard E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.

Century Products**800-837-4044 / 216-468-2000 - www.gracobaby.com**

30)	Accel 45100, 45200, 45600, 45700	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
-----	----------------------------------	-------------------	---

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>

Century (continued)

- | | | | |
|-----|--|-----------------------|---|
| 31) | Bravo
44622, 44630, 44631,
44662 | 04/09/01-
05/10/01 | Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info. |
| 32) | Encore
44612, 4662 | 04/09/01-
05/10/01 | Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info. |
| 33) | Smart Move
44709 | 04/09/01-
05/10/01 | Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info. |

Chicco**800-807-8817 / 877-424-4226 - www.chiccousa.com**

- | | | | | |
|-----|--|-----|-----------------------|--|
| 34) | Key Fit
Key Fit 30
Cortina Travel
Systems
BASES ONLY | All | 02/26/08-
03/17/08 | Recall applies only to <u>bases</u> manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained. |
|-----|--|-----|-----------------------|--|

35) **Chrysler****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**36) **Collier-Keyworth****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****Combi USA****800-992-6624 / 803-548-6633 - www.combi-intl.com**

- | | | | | |
|-----|---|------------------------------|---|---|
| 37) | Avatar
8100 | 11/12/03-
05/07/04 | Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made. | |
| 38) | Centre ST
Centre DX
Centre EX
Centre ARB | 8065
8074
8086
8520 | 10/19/05-
12/15/07 | The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats. |
| 39) | Shuttle
8087 | 10/19/05-
12/15/07 | The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats. | |

Compass Baby**888-899-2229 - www.compassbaby.com**

- | | | | |
|-----|---|---|---|
| 40) | Infant Car Seat
I420 ARD
I420 FUE
I420 MAR | 05/07/06,
05/13/06,
and
05/15/06 | The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit. |
|-----|---|---|---|

Cosco**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com**

- | | | | |
|-----|---|-----------------------|---|
| 41) | Alpha Omega
02-331, 02-332, 02-531,
02-533, 02-537, 02-555. | 11/17/00-
01/10/01 | Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit. |
|-----|---|-----------------------|---|

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Cosco (continued)

42)	Alpha Omega Alpha Omega Elite	22150, 22180, 22269 22155	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
43)	Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95- 01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
44)	Designer 22	22-300-JOS GB1B	08/19/03- 10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
45)	DreamRide	22-001FSM	12/01/03- 04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
46)	High Rise Booster	22-297, 22-298, 22-299	10/01/03- 10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
47)	Regal Ride	22139MON	09/28/04- 09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
48)	Touriva	22100x, 22111x, 22130x, 93100x, 93111x	09/28/04- 09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
49)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95- 01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]

50) **Downunder**

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Eddie Bauer

Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com

51)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00- 01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
52)	3-in-1	All Models	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
53)	Alpha Omega Alpha Omega Elite	22750 22755, 22756, 22757, 22770	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
54)	Comfort Infant Seat	22631 LNG, 22630 AFD, 22630 BAL, 22630 FTM, 22630 HPN, 22630 LRS, 22630 LKM.	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
55)	Comfort Infant Seat	22631 LNG, 22630 AFD, 22630 BAL, 22630 FTM, 22630 HPN, 22630 LRS, 22630 LKM.	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Eddie Bauer (continued)

56)	Deluxe 3-in-1	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
57)	Deluxe Convertible	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
58)	Designer 22	22-625 AFD GB1B 22-625 GLC GB1B 22-625 EDG GB1B 22-625 MAC GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
59)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

Evenflo**800-525-2472 / 800-233-5921 / 800-490-7497 - www.evenflo.com**

60)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	ALL (11/01/01-08/31/02)	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
61)	Discovery	390, 391, 534, 552	Pre-02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
62)	Discovery	3021769Z, 3021854Z	02/04/08	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.
63)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre-04/08/06	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
64)	On My Way	Begins with 200, 211, 447, 499	Pre-02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
65)	On My Way base	639001, 639002	Pre-02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
66)	Tribute	378x, 379x	09/08/05-09/22/05	Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.
67)	Triumph	264x, 359x, 389x	09/06/01-10/31/05	Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
68)	Triumph	264x	10/20/01-01/31/02	Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.

69) **Fisher Price****REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS**70) **Ford****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**71) **General Motors****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
72)	Gerry	<i>REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS</i>
	Graco	800-345-4109 - www.gracobaby.com
73)	CarGo 8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x	01/09/07- An incorrect NHTSA Hotline telephone number appears on an information label 03/03/08 affixed to the back of the seat. Contact mfg. for a replacement label.
74)	ComfortSport 8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07- Lower Anchorage belt may have been misrouted during assembly process. Use the 07/31/07 vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.
75)	ComfortSport 8C02MRC2	10/22/07 Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.
76)	ComfortSport 8C04FRR, 8C04FRR2	11/01/06- Seats were equipped with a large supplemental "body pillow" that partially obscures 10/08/07 the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.
77)	SnugRide #'s 7493, 7497, 7499, 841101, 841102, 841103, 841203, 841202, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478 <i>See Note</i>	08/31/99-02/28/02 May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.
78)	SnugRide #'s 8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02-03/08/03 May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
79)	SnugRide 8609x, 8616x, 8643x, 8645x, 8646x	08/01/06- The backing of the seat pad may pull away from the seams in an area reachable to 06/30/07 the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.
80)	International	<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
81)	Kolcraft	<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
82)	Lin Lih/MCP Ent.	<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
	Mercedes-Benz USA	800-367-6372 - www.mbusa.com
83)	Kiddy TopSafe B66868203 (mfg. by B66868204 Sicartex) B66868209	03/01/03- Lower LATCH attachment may not be strong enough to hold in the event of a crash. 11/30/03 Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Model #</i>	<i>Mfg Date Problem Type and Consumer Action</i>
Mia Moda 866-642-6632 - www.miamodainc.com		
84)	Viva 5000, 5001	12/19/06-02/06/07 The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.
Peg Perego USA 877-737-3468 / 219-482-8191 - www.perego.com		
85)	Jacadi IMCB00JA57RJ31JU31	07/01/07-03/14/08 The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit.
86)	Primo Viaggio CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01 The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
87)	Primo Viaggio CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02 The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg, for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
88)	Primo Viaggio SIP 30/30 32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61FG13ST53, 61FG53ST49, 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53	07/01/07-03/14/08 The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. Note: Affected model numbers begin with IMUN00US.
Playskool Contact Kolcraft: 800-453-7673		
89)	Infant Car Seat 77005, 77007	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
90)	Pride Trimble/Virco	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
91)	Questor	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
Recaro 800-873-2276 / 248-364-3818 - www.recaro-nao.com		
92)	Como 331.00.xxx	Pre-09/17/07 Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
93)	Como 331.00.xxx	Pre-12/18/07 The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
>>94)	Como 331.00.xxx, 331.01.xxx	11/01/07-02/16/09 The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>Model Name</i>	<i>Model #</i>	<i>Mfg Date Problem Type and Consumer Action</i>
Recaro (continued)		
95)	Signo 331.00.xxx	Pre-12/18/07 The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
>> 96)	Signo 330.00.xxx, 330.01.xxx	11/01/07-02/16/09 The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.
<hr/>		
97)	Renolux (FBS)	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
<hr/>		
Safeline Kids (See Triple Play Products also)		800-829-1625 - www.tripleplayproducts.com
98)	Sit'n'Stroll 2003	09/01/02-10/21/03 Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.
99)	Sit'n'Stroll 2240	04/01/01-10/01/01 The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.
<hr/>		
Safety 1st		Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com
100)	Alpha Elite All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
101)	Alpha Omega 22151 Alpha Omega 22455 Elite	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
102)	Alpha Sport All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
103)	Designer 22 02-621-SAL, 02-620-AZY, 02-620-BEA	01/03/02-02/13/02 Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
104)	Designer 22 22-325 CMB GB1B 22-325 VIN GB1B 22-325 DTA GB1B 22-325 TST GB1B	08/19/03-10/20/04 Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
105)	Enspira 22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
106)	Intera 22460	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
<hr/>		
Snug Seat		800-336-7684 - www.snugseat.com
107)	Gorilla 200-1000	07/26/02-01/15/03 A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
<i>#</i>	<i>Model Name</i>	<i>Mfg Date Problem Type and Consumer Action</i>
Snug Seat (continued)		
108)	Spelcast 600-1000	07/26/02- A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. 01/15/03 Contact mfg. for replacement kit # FW-50250-12-ZY
109)	Traveller Plus E9L32 (Mfg. by Britax for Snug Seat)	Pre- The adjuster strap may slip within the metal buckle that controls the tightness of the 07/24/04 shoulder harness and may allow the harness to loosen. <u>Contact Britax</u> at 800-683-2045 or 704-409-1700 for repair kit.
110)	Strolee	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
Team-Tex America		877-912-1313
111)	Babyride 374099	08/31/06- Belt routing label with "horizontal reference line" was incorrectly placed on the CR. 10/23/06 Contact mfg. for a correct label and placement instructions. NOTE: According to Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.
112)	Babyride 374199	12/18/08 The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.
TriplePlay Products (See Safeline Kids also)		800-829-1625 - www.tripleplayproducts.com
>> 113)	Sit'n'Stroll 4002	05/05/08 The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.
114)	TRW	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
XSCi		800-630-6850 / 719-593-8881
115)	Pioneered ACIS None*	02/01/02- Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle 03/07/02 can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.**

Integrated (built-into the vehicle) seats

	<i>Manufacturer</i>	<i>Model Year</i>	<i>Customer Assistance</i>
	Chrysler		800-853-1403 / 800-992-1997
116)	Town and Country	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
117)	Town and Country	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
118)	Town and Country	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
119)	Town and Country	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
	Dodge		800-853-1403 / 800-992-1997
120)	Caravan Grand Caravan	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
121)	Caravan Grand Caravan	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
122)	Caravan Grand Caravan	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
123)	Caravan Grand Caravan	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
	Ford		800-392-3673
124)	Windstar	1998	The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.
	Plymouth		800-853-1403 / 800-992-1997
125)	Voyager Grand Voyager	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
126)	Voyager Grand Voyager	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
127)	Voyager Grand Voyager	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
128)	Voyager Grand Voyager	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.

Child restraints (CRs) manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of May 29, 2009.** Updated versions of this list and a listing of recalls on models less than 10 years old are posted on-line at www.hsrb.unc.edu.

CHILD RESTRAINTS AT LEAST 10 YEARS OLD

Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names.

Alcot (Childcare)	# 11-650	229	# 4513	246	5000 STE	233, 234, 235, 236, 237
Child Love Seat	# 12-565	246	# 4515	246	5500 STE	238
	# 4100	212, 213	# 4516	246	580	239, 240
All Our Kids	# 4153	214	# 4518	246	Affinity	241
# 600	# 4163	214	# 4520	247	Breverra Contour	242
# 602	# 4180	214	# 4525	248	Breverra Premiere	243
Little Cargo Vest	# 4200	215, 216, 217, 218	# 4535	245	Child Love Seat	244
	# 4210	215, 216, 217, 218	# 4551	246	Infant Car Seat	245, 246
American Motors	# 4214	215, 216, 217, 218	# 4557	246	Infant Love seat	247
Child Love Seat	# 4223	215, 216, 217, 218	# 4558	246	Smart Fit	248
Infant Love Seat	# 4235	215, 216, 217, 218	# 4559	246	Smart Move	249
	# 4253	219, 220, 221	# 4560	245		
Babyhood Industries	# 4261	220, 221	# 4564	246		
# 810	# 4263	219, 220, 221	# 4565	245, 246	Chrysler	
# 8200	# 4265	219, 220, 221	# 4566	246	Child Love Seat	250
Baby-Sitter	# 4266	220, 221	# 4568	246		
Wonda Chair	# 4300	222	# 4569	246	Collier-Keyworth	
	# 4302	222	# 4575	241, 246	Co-Pilot	251
Basic Comfort	# 4303	222	# 4576	246	Commuter	253
# 960	# 4310	222	# 4580	240	Safe and Sound II	252
# 961	# 4323	222	# 4581	239, 240		
Galaxy 2000	# 4334	222	# 4583	239, 240	Cosco	
	# 4335	222	# 4585	239, 240	# 02-014-EMF	268
Bolform Corp.	# 4353	224, 225, 227	# 4589	246	# 02-014-GDM	268
# 84E-019	# 4365	224, 225, 226, 227	# 4590	245	# 02-015-PDL	268
Buckle-Up Harness	# 4365DT	223	# 4591	246	# 02-084	267, 270
	# 4366	223, 224, 225, 226, 227	# 4593	246	# 02-086	256
Britax	# 4367	226, 227	# 4594	246	# 02-090	264
# 101	# 4368	224, 225, 226, 227	# 4595	246	# 02-094	270
# 161	# 4369	226, 227	# 4597	246	# 02-096	270
Freeway	# 4380	226, 228	# 4600	244	# 02-190	266
Roundabout	# 4381	226	# 4750	249	# 02-290	265
	# 4400	231, 232	# 4875	242	# 02-404	270
Century	# 4434	231, 232	# 4885	243	# 02-514-BWE	269
# 11-564	# 4436	231, 232	100	212, 213	# 02-518-NDF	269
# 11-565	# 4446	231, 232	1000 STE	214	# 02-584-OXF	269
# 11-570	# 4450	233, 234, 236, 237	200	215, 216, 217, 218	# 02-719 ARQ	257
# 11-575	# 4460	233, 234, 235, 236, 237	2000 STE	219, 220, 221	# 02-729 TED	255
# 11-576	# 4470	234, 235, 236, 237	300	222	# 02-751	254
# 11-578	# 4475	233, 234, 235, 236, 237	3000 STE	223, 224, 225, 226, 227	# 02-790	258
# 11-595	# 4476	235, 236	3500 STE	228	# 02-821	270
# 11-597	# 4480	235, 238	4-In-1	229, 230	# 02-890	258
# 11-598	# 4490	235, 238	400XL	231, 232	# 181A	259
# 11-599	# 4500	247			# 181B	259
# 11-600	# 4510	247			# 313	261

Cosco (continued)	# 416	276	General Motors	Rock 'N' Ride	349, 350
# 323	# 4176	290	Child Love Seat	Secura	351
# 423	# 420	299	Infant Love Seat	Secure Fit	352
# 81A	# 435x	286		Travel About	353, 354
# 81B	# 441	282, 283, 285	Gerry	Travel-About	355
Arriva	# 442	282, 283, 285	# 626	Traveler 700	356, 357, 358
Commuter	# 443	282, 283, 285	Guardian		
Dream Ride	# 444	282, 283, 285	Secure Ride		
Lxry Sft Shld Auto Trac	# 445	282, 283, 285		Lin Lih/MCP	
Safe and Easy	# 446	282, 283, 285		# 180-200	360
Safe and Snug	# 447	282, 283, 285	Graco	# 180-300	360
Safe-T Mate	# 448	282, 283, 285	GT 1000	Lin Lih	359, 360
Safe-T-Shield	# 453	293, 294			
Sft Shld Auto Trac	# 454	293, 294	International	Mercedes-Benz	
Soft Shield	# 456	284, 285	Astroseat	# BQ6910155	362
Soft Shield Deluxe	# 458	284, 285		# BQ6910157	361
Touriva	# 458	284, 285	Kolcraft	# BQ691063	361
Voyager Inf/Stroller	# 470	277, 278	# 131-101	Booster Seat	361
	# 471	277, 278	# 13123	Infant Restraint	362
	# 492x	288	# 1312x		
Downunder	# 493x	286	# 1382x		
Kangaroo Booster	# 493x	286	# 13833	Playskool	
	# 636x	298	# 1383x	# 140-155	363
	# 637x	298	# 13842	# 180-400	363
Evenflo	410	274	# 1384x	# 77001	364
# 201	Bobby Mac Champion	275	# 1384x	# 77002	364
# 202	Bobby Mac Deluxe	276	# 13852	Car Seat	363, 364
# 203x	Booster Seat	277, 278	# 1385x		
# 205x	Champion	279, 280, 281	# 138xx	Pride Trimble/Virco	
# 206	Dyn-O-Mite	282, 283	# 140-155	# 832	367
# 207x	Infant Car Seat	284, 285	# 150-100	# 890	365, 366
# 210x	Joyride	286	# 180-100	# 891	365, 366
# 219164	On My Way	287, 288	# 180-150	# 892	365, 366
# 219180	One-Step	289	# 180-200	Click-n-Go	365, 366
# 219186	One-Step Deluxe	290	# 180-300	Pride Ride	367
# 219188	Scout	291, 292	# 180-400		
# 21940	Seven Year Seat	293, 294	# 180-600	Questor	
# 219x	Sidekick	263	# 180-601	Kantwet Car Seat	368
# 221	Travel Tandem	295, 296	# 19127		
# 222	Trooper	271, 297	# 19128	Renolux (FBS)	
# 223	Two-in-One	298	# 19129	GT 1000	369
# 224x	Ultara 1	299, 300	# 19130	GT 2000	370, 371, 372
# 225x	Ultara II	301, 302	# 19131	GT 4000	373, 374
# 227			# 368xx	GT 5000	375, 376
# 228			# 43xxx	GT 5000 Turn A Tot	377, 378, 379
# 229x	Fisher Price		# 77001	GT 5500	380, 381
# 231	# 79700	317	# 77002	GT 7000	382, 383, 384
# 232	# 9100	303, 304, 305, 306, 307, 308, 309, 310, 311	# 77005		
# 242	# 9101	304, 305, 307, 308, 309, 310, 311	# 77007	Safeline Kids	
# 244x	# 9104	312, 315, 316	Automate	# 3240	385
# 401	# 9149	313	Carter Travel 5	Sit'n'Stroll	385
# 402	# 9173	314	Dial-A-Fit		
# 403	Booster	315, 316	Dial-A-Fit II	Safeline Kids (see Triple Play also)	
# 404	Car Seat	303, 304, 305, 306, 307, 308, 309, 310, 311	Flip 'N' Go	# 3240	386
# 405	Delux Car Seat	312	Flip 'N' Go II	Sit'n'Stroll	386
# 406	Infant Seat	313, 314	Infant Car Seat		
# 407	Safe Embrace	317	Infant Restraint	Strolee	
# 408			Infant Rider	# 599	388
# 409			Perfect Fitt	# 605	390
# 410	Ford		Performa	# 609	389
# 411	Infant Love Seat	318	Playskool	# 610	389
# 412			Playskool Infant	GT 3000	391
# 414			Plus 4		
# 415			Plus 5		

Strolee (continued)

Quick Click 390
Wee Care 387, 388, 389

TRW

Child Love Seat 393
Infant Love Seat 392

Volvo

All 394

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
Alcot (Childcare)		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
200)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
All Our Kids		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
201)	Little Cargo Vest	600	4/93-3/94	Flammability of upholstery. Call mfg. for repair info.
202)	Little Cargo Vest	602	3/94-9/94	Flammability of upholstery. Call mfg. for repair info.
American Motors		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
203)	Infant Love Seat	All	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
204)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
Babyhood Industries		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
205)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
206)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.
Basic Comfort		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
207)	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
208)	Galaxy 2000	960, 961	11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
Bolform Corp.		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE		
209)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
Britax		888-427-4829 / 704-409-1700 www.britaxusa.com		
210)	Freeway	101	6/96-4/97	Buckle. Call mfg. for repair info.
211)	Roundabout	161	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
Century Products		800-837-4044 / 216-468-2000		
212)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
213)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
214)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
215)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
216)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
217)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action
<i>Century Products (continued)</i>				
218)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
219)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
220)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
221)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
222)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
223)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
224)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
225)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
226)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
227)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
228)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
229)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
230)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
231)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
232)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
233)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
234)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
235)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
236)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
237)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
238)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
239)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
240)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
241)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
242)	Brevera Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
243)	Brevera Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
244)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
245)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

Century Products (continued)

246)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
247)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
248)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
249)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.

Chrysler**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

250)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	-----------------	-----	------------	---

Collier-Keyworth**800-544-1108**

251)	Co-Pilot	All	82-83	Shield. Call mfg. for repair info.
252)	Safe and Sound II	All	12/84-4/85	Buckle. Call mfg. for repair info.
253)	Commuter	All	10/87-02/88	Padding. Call mfg. for repair info.

Cosco**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141**

254)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
255)	Arriva	02-729 TED	03/31/99- 04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
256)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
257)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
258)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
259)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
260)	Safe-T Mate		1984	Wrong instructions. Call mfg. for repair info.
261)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
262)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
263)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
264)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
265)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
266)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
267)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
268)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

Cosco (continued)

269)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
270)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
271)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
272)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

Downunder***No longer in business***

273)	Kangaroo Booster Seat	All (Pre- 1/98)		Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	-----------------	--	--

Evenflo***800-525-2472 / 800-233-5921***

274)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
275)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
276)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
277)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
278)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
279)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
280)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
281)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
282)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
283)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
284)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.
285)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
286)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
287)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.
288)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
289)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
290)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
291)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
292)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
293)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Evenflo (continued)

294)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
295)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
296)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
297)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
298)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
299)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
300)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
301)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
302)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

Fisher Price**ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE**

303)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
304)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
305)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
306)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
307)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
308)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
309)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
310)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
311)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
312)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
313)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
314)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
315)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
316)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
317)	Safe Embrace	79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.

Ford**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

318)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	------------------	-----	-------	---

General Motors**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

319)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
320)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
Gerry			Contact Evenflo: 800-525-2472 / 800-233-5921	
321)	Guardian	All	01/90-05/90	Buckle. Call mfg. for repair info.
322)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label
Graco			800-345-4109 / www.gracobaby.com	
323)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
International			ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE	
324)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
Kolcraft			ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE	
325)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
326)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
327)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
328)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
329)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
330)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
331)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
332)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
333)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
334)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
335)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
336)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
337)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
338)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
339)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
340)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
341)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
342)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
343)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
344)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
345)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
346)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
347)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
348)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-----------------	---

Kolcraft (continued)

349)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
350)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
351)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
352)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
353)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
354)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
355)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
356)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
357)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
358)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

Lin Lih/MCP Ent.**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

359)	Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
360)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

Mercedes-Benz USA**800-367-6372 - www.mbusa.com**

361)	Booster	BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
362)	Infant Restraint	BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.

Playskool**Contact Kolcraft: 800-453-7673**

363)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
364)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft

Pride Trimble/Virco**800-521-5198**

365)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
366)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
367)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.

Questor**Contact Evenflo: 800-233-5921**

368)	Kantwet Car Seat	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
------	------------------	-----	-----------	---

Renolux (FBS)**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

369)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
370)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
371)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
372)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

Renolux (continued)

373)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
374)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
375)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
376)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
377)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
378)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
379)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
380)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
381)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
382)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
383)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
384)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

Safeline Kids**800-829-1625****www.tripleplayproducts.com**

385)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
386)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.

Strolee**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

387)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
388)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
389)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
390)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
391)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.

TRW**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

392)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
393)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Volvo**800-458-1552 / 800-221-9136 / 201-768-7300**

394)	ALL SEATS	All	Thru 12/88	Buckle. Call mfg. for refund info.
------	-----------	-----	------------	------------------------------------