

## **USING THE HIGHWAY SAFETY RESEARCH CENTER CHILD RESTRAINT RECALL LIST**

**Last Revisions – Newer Model List: May 7, 2012**  
**Older Model List: May 7, 2012**

### **About Child Restraints and Recalls**

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Many recalls are issued are due to reasons related to the crashworthiness of the child restraint, but some recalls are for deviations from the standards relating to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Child restraints (CRs) are required to have a label indicating the manufacturer, model information, and date of manufacture. CRs should not be used if the labels are missing such that the manufacturer, model name, number, and date of manufacture cannot be determined.

Child restraint manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the restraints unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current restraint or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected child restraint or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236.

### **About Older Child Restraints and Recalls**

Child restraints manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years and some child restraints are stamped with an expiration date. Parents and other caregivers are encouraged to contact the child restraint manufacturer for model specific recommendations.

Older models, those manufactured since 1981, are included as a part of the HSRC recall list because parents and other care givers will sometimes choose to use child restraints older than ten years even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect can be corrected, should help to encourage the care giver to destroy the older CR and obtain a new one.

## About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) child restraint (CR) recall list identifies recalls and safety notifications for child restraint systems known by the HSRC at the time it is published. This list is updated by HSRC as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. To be notified via email whenever the HSRC Recall List is updated, go to [www.hsrc.unc.edu/recalls](http://www.hsrc.unc.edu/recalls) and click on the link to "Sign up for automatic email notification of updates to the HSRC recall list."

The HSRC recall list is formatted in a relatively compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this list are encouraged to obtain more detailed information about recent recalls through the "Most Recent Car Seat Recall Announcements and Notices" page of the HSRC Recall List website. Users of this (or any other) recall list should remind parents/caregivers to contact the CR manufacturer to be certain whether or not a particular CR is affected by any recalls.

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of child restraints where most or all of the effected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised.

## Instructions for Using the PDF Version of the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the child restraint itself. Using this information:

1. Look to see if the manufacturer and model name and/or model number are listed in the index\*. **Child restraints under recall are listed in the index by both model name and model number.** Each entry on the list and in the index is assigned a "List #" based on its location in the list. The list is alphabetized by manufacturer and model name. List #'s for individual models will change in subsequent lists as models are added to or removed from the list.
2. If that model name or model number is listed in the index, note the "List # (number)" and use the List # to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the child restraint.
3. If the restraint is included in the recall, the CR manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
4. If the manufacturer has gone out of business or discontinued their repair or replacement program, the CR should be destroyed after a replacement restraint is obtained.
5. If the restraint is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the restraint's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

\*Note that Dorel Juvenile Group (DJG) products are indexed under each individual product line (Alpha Elite, Beatrix Potter, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1st) as well as under the broader "Dorel" label.

For further information, contact:

Bill Hall or Bevan Kirley  
The University of North Carolina Highway Safety Research Center  
CB# 3430, Chapel Hill, NC 27599  
919-962-2202 or (in NC) 800-672-4527 or [cps@hsrc.unc.edu](mailto:cps@hsrc.unc.edu)

The following lists identify recalls and safety notifications for child restraints (CRs) known by the UNC Highway Safety Research Center (HSRC) as of May 7, 2012. This list is updated by HSRC as soon as possible after recall notifications are announced. Updated versions are available on-line at [www.hsrc.unc.edu](http://www.hsrc.unc.edu) or by phone at 919-962-2202 or 800-672-4527 (in NC). The most recent addition(s) to the list is/are denoted by ">>".

CRs are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. Model numbers followed by one or more "x" should be read as "model numbers beginning with." If the label is missing on your CR, contact the manufacturer to see if it can be identified through other information. **A CR should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

CRs manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Models older than ten years and under recall are included on a separate list with a separate index.** The index for older models can be found following the last page of the "Models Less Than 10 Years Old" recall list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised May 7, 2012.**

Some of the recalls/notifications for CRs on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific CR is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current CR or to obtain another one until the problem can be corrected.

**In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the CR and obtain and use another one as soon as possible.** Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded CRs should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected safety seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236.

## CHILD RESTRAINTS LESS THAN 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names. **Note:** Dorel Juvenile Group products are indexed under each individual product line (Alpha Elite, Alpha Sport, Beatrix Potter, Bertini, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1<sup>st</sup>) as well as under "Dorel."

<p><b>Alcot</b> ALL MODELS ..... 1</p> <p><b>All Our Kids</b> ALL MODELS ..... 2</p> <p><b>Alpha Elite (Dorel)</b> # 22148x ..... 4 # 22149x ..... 4 # 22158x ..... 4 # 22331 BLA ..... 5, 6 # 22332 RLA ..... 5, 6 # 22459x ..... 4 # 22462x ..... 3 Alpha Luxe ..... 3 Alpha Omega All-N-1 ..... 4 Alpha Omega Elite ..... 4 Comfort Infant Seat ..... 5, 6</p>	<p><b>Alpha Sport (Dorel)</b> # 22452x ..... 7 # 22458x ..... 7 # 22546x ..... 8 # 22547x ..... 8 Enspira ..... 7 Vantage ..... 8</p> <p><b>American Motors</b> ALL MODELS ..... 9</p> <p><b>Baby Trend</b> # 6400 ..... 11 # 6439 ..... 10 # 6448 ..... 10 # 6481 ..... 10 Rigid Latch-Loc ..... 10 Rigid Latch-Loc Base ..... 11</p>	<p><b>Babyhood Industries</b> ALL MODELS ..... 12</p> <p><b>Basic Comfort</b> ALL MODELS ..... 13</p> <p><b>Beatrix Potter (Dorel)</b> ALL MODELS ..... 14</p> <p><b>Bertini (Dorel)</b> # 22346x ..... 15 SureFit ..... 15</p> <p><b>Bolform</b> ALL MODELS ..... 16</p>
---	--	---

<b>Britax</b>		Avatar .....	38	<b>Dorel</b>	
# E906 .....	29	Centre .....	39	(Beatrix Potter) .....	14
# E9L06 .....	29	Shuttle .....	40	# 22-001FSM (Cosco) .....	47
# E9L07 .....	33			# 22-057 CLN (Safety 1st) .....	114
# E9L14 .....	20, 21, 22	<b>Compass Baby</b>		# 22-057 DBY (Safety 1st) .....	114
# E9L20 .....	21, 22	# 1420 ARD .....	41	# 22-057 HRT (Safety 1st) .....	114
# E9L30 .....	26, 27, 28	# 1420 FUO .....	41	# 22-057 LPH (Safety 1st) .....	114
# E9L32 .....	32	# 1420 MAR .....	41	# 22-085 DWA (Safety 1st) .....	114
# E9L3998 .....	30	Infant Car Seat .....	41	# 22-085 LYN (Safety 1st) .....	114
# E9L39x .....	31			# 22-095 RBK (Safety 1st) .....	114
# E9L47 .....	23	<b>Cosco (Dorel)</b>		# 22-297 (Cosco) .....	48
# E9L5490 .....	25	# 22-001FSM .....	47	# 22-298 (Cosco) .....	48
# E9L54E7 .....	24, 25	# 22-297 .....	48	# 22-299 (Cosco) .....	48
# E9L54H6 .....	24	# 22-298 .....	48	# 22-300 CSF (Cosco) .....	49
# E9L54H7 .....	24	# 22-299 .....	48	# 22-300 FZN (Cosco) .....	49
# E9L54M6 .....	24	# 22-300 CSF .....	49	# 22-300 JJV (Cosco) .....	49
# E9L57 .....	17	# 22-300 FZN .....	49	# 22-300 OSF (Cosco) .....	49
# E9L692J .....	19	# 22-300 JJV .....	49	# 22-300 THD (Cosco) .....	49
# E9L692K .....	19	# 22-300 OSF .....	49	# 22-300 TWD (Cosco) .....	49
# E9L692L .....	19	# 22-300 THD .....	49	# 22-300-JOS GB1B (Cosco) .....	46
# E9L692M .....	19	# 22-300 TWD .....	49	# 22-305 NAB (Disney) .....	53
# E9L69P2 .....	18	# 22-300-JOS GB1B .....	46	# 22-305 PPH (Disney) .....	53
# E9L69P3 .....	18	# 22100x .....	51	# 22-322 HRR (Safety 1st) .....	114
# E9L69P5 .....	18	# 22111x .....	51	# 22-322 KDL (Safety 1st) .....	114
# E9L80 .....	21, 22	# 22130x .....	51	# 22-322 LXI (Safety 1st) .....	114
# E9W06 .....	29	# 22139MON .....	50	# 22-322 MAI (Safety 1st) .....	114
Boulevard .....	17	# 22150 .....	42	# 22-322 OLY (Safety 1st) .....	114
Chaperone .....	18, 19	# 22150x .....	43	# 22-322 PRS (Safety 1st) .....	114
Companion .....	20, 21, 22	# 22154x .....	44	# 22-322 PTK (Safety 1st) .....	114
Decathlon .....	23	# 22155 .....	42	# 22-325 COB (Safety 1st) .....	114
Frontier .....	24, 25	# 22155x .....	44	# 22-325 PAC (Safety 1st) .....	114
Husky .....	26, 27	# 22158x .....	44	# 22-325 xxx GB1B (Safety 1st) .....	110
Marathon .....	28, 29	# 22180 .....	42	# 22-355 LBF (Disney) .....	53
Regent .....	30, 31	# 22269 .....	42	# 22-355 PWK (Disney) .....	53
Traveller Plus .....	32	# 93100x .....	51	# 22-371 (Eddie Bauer) .....	86
Wizard .....	33	# 93111x .....	51	# 22-371 HFL (Maxi-Cosi) .....	87
		# IC123 FSM .....	45	# 22-371 JUC (Maxi-Cosi) .....	87
<b>Century</b>		Alpha Omega .....	42	# 22-371 LMD (Maxi-Cosi) .....	87
ALL MODELS .....	34	Alpha Omega All-N-1 .....	43	# 22-371 ORE (Maxi-Cosi) .....	87
		Alpha Omega Elite .....	42, 44	# 22-371 PNG (Maxi-Cosi) .....	87
<b>Chicco</b>		Comfy Carry .....	45	# 22-372 (Eddie Bauer) .....	86
# All .....	35	Designer 22 .....	46	# 22-372 TTH (Maxi-Cosi) .....	87
Cortina Travel System .....	35	DreamRide .....	47	# 22-380 LGA (Safety 1st) .....	114
Key Fit .....	35	High Rise Booster .....	48	# 22-380 MSA (Safety 1st) .....	114
Key Fit 30 .....	35	Infant Car Seat .....	49	# 22-515 (Eddie Bauer) .....	86
		Regal Ride .....	50	# 22-515 BLK (Maxi-Cosi) .....	87
<b>Childcare</b>		Touriva .....	51	# 22-625 xxx GB1B (Eddie Bauer) .....	60
ALL MODELS .....	1			# 22-627 AWF (Disney) .....	53
		<b>Cybox (Regal Lager)</b>		# 22-627 CGT (Eddie Bauer) .....	63
<b>Chrysler [Aftermarket]</b>		# 0500200xx .....	52	# 22-627 FRK (Eddie Bauer) .....	63
ALL MODELS .....	36	# 0500760xx .....	52	# 22-627 KGS (Eddie Bauer) .....	63
		Solution X-fix .....	52	# 22-627 SNW (Eddie Bauer) .....	63
<b>Chrysler [Integrated]</b>				# 22-627 WAV (Safety 1st) .....	114
Town and Country .....	129, 130, 131, 132	<b>Disney (Dorel)</b>		# 22-627 WPR (Eddie Bauer) .....	63
		# 22-305 NAB .....	53	# 22-655 BYTE (Eddie Bauer) .....	63
<b>Collier-Keyworth</b>		# 22-305 PPH .....	53	# 22077x (Safety 1st) .....	115
ALL MODELS .....	37	# 22-355 LBF .....	53	# 22078x (Safety 1st) .....	115
		# 22-355 PWK .....	53	# 22100x (Cosco) .....	51
<b>Combi</b>		# 22-627 AWF .....	53	# 22111x (Cosco) .....	51
# 8065 .....	39	Infant Car Seat .....	53	# 22130x (Cosco) .....	51
# 8074 .....	39			# 22139MON (Cosco) .....	50
# 8086 .....	39	<b>Dodge [Integrated]</b>		# 22148x (Alpha Elite) .....	4
# 8087 .....	40	Caravan .....	133, 134, 135, 136	# 22149x (Alpha Elite) .....	4
# 8100 .....	38	Grand Caravan .....	133, 134, 135, 136	# 22150 (Cosco) .....	42
# 8520 .....	39				

**Dorel (Continued)**

# 22150x (Cosco)	43
# 22151 (Safety 1st)	106
# 22152x (Safety 1st)	107
# 22154x (Cosco)	44
# 22155 (Cosco)	42
# 22155x (Cosco)	44
# 22158x (Alpha Elite)	4
# 22158x (Cosco)	44
# 22159x (Safety 1st)	107
# 22172x (Safety 1st)	107
# 22177x (Safety 1st)	107
# 22178x (Safety 1st)	107
# 22180 (Cosco)	42
# 22185x (Safety 1st)	107
# 22188x (Safety 1st)	107
# 22195x (Safety 1st)	107
# 22269 (Cosco)	42
# 22331 BLA (Alpha Elite)	5, 6
# 22332 RLA (Alpha Elite)	5, 6
# 22346x (Bertini)	15
# 22356x (Safety 1st)	115
# 22371x (Maxi-Cosi)	88
# 22372x (Maxi-Cosi)	88
# 22412x (Safety 1st)	107
# 22439x (Safety 1st)	109
# 22449x (Safety 1st)	109
# 22450 (Safety 1st)	111
# 22451 (Safety 1st)	111
# 22452 (Safety 1st)	111
# 22452x (Alpha Sport)	7
# 22453 (Safety 1st)	111
# 22453x (Safety 1st)	112
# 22455 (Safety 1st)	106
# 22456x (Safety 1st)	107
# 22458x (Alpha Sport)	7
# 22459x (Alpha Elite)	4
# 22460 (Safety 1st)	113
# 22462x (Alpha Elite)	3
# 22465x (Safety 1st)	107
# 22469x (Safety 1st)	107
# 22475x (Safety 1st)	118
# 22476x (Maxi-Cosi)	89
# 22480 (Safety 1st)	111
# 22481 (Safety 1st)	111
# 22486x (Maxi-Cosi)	89
# 22546x (Alpha Sport)	8
# 22547x (Alpha Sport)	8
# 22553x (Safety 1st)	119
# 22554x (Safety 1st)	119
# 22560x (Safety 1st)	119
# 22561x (Safety 1st)	119
# 22564x (Safety 1st)	119
# 22567x (Safety 1st)	119
# 22574x (Safety 1st)	119
# 22580x (Safety 1st)	117
# 22630xxx (Eddie Bauer)	57, 58
# 22631xxx (Eddie Bauer)	57, 58
# 22657x (Eddie Bauer)	65
# 22740 (Eddie Bauer)	55, 61
# 22740x (Eddie Bauer)	62
# 22741x (Eddie Bauer)	62
# 22750 (Eddie Bauer)	55, 56
# 22755 (Eddie Bauer)	55, 56

# 22755x (Eddie Bauer)	59
# 22756 (Eddie Bauer)	55, 56
# 22757 (Eddie Bauer)	55, 56
# 22758x (Eddie Bauer)	59
# 22759x (Eddie Bauer)	59
# 22770 (Eddie Bauer)	55, 56
# 22790x (Eddie Bauer)	59
# 22799x (Eddie Bauer)	59
# 22880x (Eddie Bauer)	64
# 93100x (Cosco)	51
# 93111x (Cosco)	51
# IC072x (Eddie Bauer)	65
# IC123 FSM (Cosco)	45
# IC124 FSM (Safety 1st)	116
3-in-1 (Eddie Bauer)	55
Alpha Elite (Safety 1st)	105
Alpha Luxe (Alpha Elite)	3
Alpha Omega (Cosco)	42
Alpha Omega (Eddie Bauer)	56
Alpha Omega (Safety 1st)	106
Alpha Omega All-N-1 (Alpha Elite)	4
Alpha Omega All-N-1 (Cosco)	43
Alpha Omega All-N-1 (Safety 1st)	107
Alpha Omega Elite (Alpha Elite)	4
Alpha Omega Elite (Cosco)	42, 44
Alpha Omega Elite (Eddie Bauer)	56
Alpha Omega Elite (Safety 1st)	106, 107
Alpha Sport (Safety 1st)	108
Avenue (Safety 1st)	109
Comfort Infant Seat (Alpha Elite)	5, 6
Comfort Infant Seat (Eddie Bauer)	57, 58
Comfy Carry (Cosco)	45
Deluxe 3-in-1 (Eddie Bauer)	55, 59
Deluxe Convertible (Eddie Bauer)	55
Designer 22 (Cosco)	46
Designer 22 (Eddie Bauer)	60
Designer 22 (Safety 1st)	110
DreamRide (Cosco)	47
Enspira (Alpha Sport)	7
Enspira (Eddie Bauer)	61, 62
Enspira (Safety 1st)	111, 112
High Rise Booster (Cosco)	48
Infant Car Seat (Cosco)	49
Infant Car Seat (Disney)	53
Infant Car Seat (Eddie Bauer)	63
Infant Car Seat (Safety 1st)	114
Intera (Safety 1st)	113
Mico (Maxi-Cosi)	86, 87, 88
OnBoard (Safety 1st)	115
OnBoard 35 (Safety 1st)	116
Priori (Maxi-Cosi)	89
Prospect (Safety 1st)	117
Prospect Adjustable Hiback Booster (Eddie Bauer)	64
Regal Ride (Cosco)	50
SureFit (Bertini)	15
SureFit (Eddie Bauer)	65
Touriva (Cosco)	51
Uptown (Safety 1st)	118
Vantage (Alpha Sport)	8
Vantage (Safety 1st)	119
Vantage Highback (Safety 1st)	119
Vantage Point/Surveyor (Safety 1st)	119

**Downunder**

ALL MODELS	54
------------	----

**Eddie Bauer (Dorel)**

# 22-625 xxx GB1B	60
# 22-627 CGT	63
# 22-627 FRK	63
# 22-627 KGS	63
# 22-627 SNW	63
# 22-627 WPR	63
# 22-655 BYTE	63
# 22630xxx	57, 58
# 22631xxx	57, 58
# 22657x	65
# 22740	55, 61
# 22740x	62
# 22741x	62
# 22750	55, 56
# 22755	55, 56
# 22755x	59
# 22756	55, 56
# 22757	55, 56
# 22758x	59
# 22759x	59
# 22770	55, 56
# 22790x	59
# 22799x	59
# 22880x	64
# IC072x	65
3-in-1	55
Alpha Omega	56
Alpha Omega Elite	56
Comfort Infant Seat	57, 58
Deluxe 3-in-1	55, 59
Deluxe Convertible	55
Designer 22	60
Enspira	61, 62
Infant Car Seat	63
Prospect Adjustable Hiback Booster	64
SureFit	65

**Evenflo**

# 264x	72
# 3021769Z	67
# 3021854Z	67
# 31011048	70
# 31011049	70
# 31011057C	70
# 31011059	70
# 3101198	70
# 3101980	70
# 317xx	68
# 320xx	68
# 359x	72
# 3604098	69
# 378x	71
# 379x	71
# 389x	72
# 390	66
# 391	66
# 397xx	68
# 398xx	68
# 534	66
# 540xx	68

**Eddie Bauer (Continued)**

# 548xx	68
# 549xx	68
# 550xx	68
# 552	66
# 556xx	68
# 597xx	68
# 598xx	68
# 599xx	68
Discovery	66, 67
Embrace	68
First Choice	69
Maestro	70
Tribute	71
Triumph	72

**Fisher Price**

ALL MODELS	73
------------	----

**Ford [Aftermarket]**

ALL MODELS	74
------------	----

**Ford [Integrated]**

Windstar	137
----------	-----

**General Motors [Aftermarket]**

ALL MODELS	75
------------	----

**Gerry**

ALL MODELS	76
------------	----

**Graco**

# 8402	81
# 8402L	81
# 8403x	81
# 8412	81
# 8433x	78
# 8442x	81
# 8443	81
# 8443L	81
# 8444	81
# 8444L	81
# 8446	81
# 8446L	81
# 8447	81
# 8447L	81
# 8448	81
# 8448L	81
# 8457	81
# 8458	81
# 8459	81
# 8463x	81
# 8464	81
# 8470	81
# 8471	81
# 8478	81
# 8487x	77
# 8601	81
# 8602x	81
# 8603M	81
# 8605x	81
# 8607x	81
# 8608D	81
# 8609x	82
# 8616x	82

# 8629x	78
# 8630x	78
# 8631x	78
# 8632x	78
# 8635x	78
# 8639x	78
# 8643x	82
# 8645x	82
# 8646x	82
# 8686x	77
# 8689x	77
# 8C00x	78
# 8C01x	78
# 8C02MRC2	79
# 8C02x	78
# 8C03x	78
# 8C04FRR	80
# 8C04FRR2	80
# 8C04x	78
# 8D01x	77
# 8D02x	77
# 8D03x	77
# 8D04x	77
# 8D05x	77
# 8D10x	77
# C844342	81
CarGo	77
ComfortSport	78, 79, 80
SnugRide	81, 82

**International**

ALL MODELS	83
------------	----

**Kolcraft**

ALL MODELS	84
------------	----

**Lin Lih/MCP**

ALL MODELS	85
------------	----

**Maxi-Cosi (Dorel)**

# 22-371	86
# 22-371 HFL	87
# 22-371 JUC	87
# 22-371 LMD	87
# 22-371 ORE	87
# 22-371 PNG	87
# 22-372	86
# 22-372 TTH	87
# 22-515	86
# 22-515 BLK	87
# 22371x	88
# 22372x	88
# 22476x	89
# 22486x	89
Mico	86, 87, 88
Priori	89

**Mercedes-Benz**

# B66868203	90
# B66868204	90
# B66868209	90
Kiddy TopSafe	90

**Mia Moda**

# 5000	91, 92
# 5001	91, 92
# 5050	92
# 5051	92
# 5070	92
# 5071	92
# 5080	92
# 5081	92
Viva	91, 92
Viva Supreme	92

**Peg Perego**

# 32MD41KN41	94
# 35CR13BU13	94
# 35CR13PL46	94
# 35CR24BU24	94
# 35TL49KN53	94
# 35TL53KN46	94
# 61FG13ST53	94
# 61FG53ST49	94
# 61FG53ST64	94
# 61ST13IC53	94
# 61ST34IC53	94
# 61ST48IC53	94
# CS00MU1	94
# IMCB00JA57RJ31JU31	93
Jacadi	93
Primo Viaggio SIP 30/30	94

**Playskool**

ALL MODELS	95
------------	----

**Plymouth [Integrated]**

Grand Voyager	138, 139, 140, 141
Voyager	138, 139, 140, 141

**Pride Trimble/Virco**

ALL MODELS	96
------------	----

**Questor**

ALL MODELS	97
------------	----

**Recaro**

# 330.00.xxx	102
# 330.01.xxx	102
# 331.00.xxx	98, 99, 100, 101
# 331.01.xxx	100
Como	98, 99, 100
Signo	101, 102

**Regal Lager (Cybex)**

# 0500200xx	52
# 0500760xx	52
Solution X-fix	52

**Renolux (FBS)**

ALL MODELS	103
------------	-----

**Safeline Kids (see Triple Play also)**

# 2003	104
Sit'n'Stroll	104

<b>Safety 1st (Dorel)</b>		Enspira . . . . .	111, 112
# 22-057 CLN . . . . .	114	Infant Car Seat . . . . .	114
# 22-057 DBY . . . . .	114	Intera . . . . .	113
# 22-057 HRT . . . . .	114	OnBoard . . . . .	115
# 22-057 LPH . . . . .	114	OnBoard 35 . . . . .	116
# 22-085 DWA . . . . .	114	Prospect . . . . .	117
# 22-085 LYN . . . . .	114	Uptown . . . . .	118
# 22-095 RBK . . . . .	114	Vantage . . . . .	119
# 22-322 HRR . . . . .	114	Vantage Highback . . . . .	119
# 22-322 KDL . . . . .	114	Vantage Point/Surveyor . . . . .	119
# 22-322 LXI . . . . .	114		
# 22-322 MAI . . . . .	114	<b>Snug Seat</b>	
# 22-322 OLY . . . . .	114	# 200-1000 . . . . .	120
# 22-322 PRS . . . . .	114	# 600-1000 . . . . .	121
# 22-322 PTK . . . . .	114	# E9L32 . . . . .	122
# 22-325 COB . . . . .	114	Gorilla . . . . .	120
# 22-325 PAC . . . . .	114	Spelcast . . . . .	121
# 22-325xxxGB1B . . . . .	110	Traveller Plus . . . . .	122
# 22-380 LGA . . . . .	114		
# 22-380 MSA . . . . .	114	<b>Strolee</b>	
# 22-627 WAV . . . . .	114	ALL MODELS . . . . .	123
# 22077x . . . . .	115		
# 22078x . . . . .	115	<b>Team-Tex</b>	
# 22151 . . . . .	106	# 374099 . . . . .	124
# 22152x . . . . .	107	# 374199 . . . . .	125
# 22159x . . . . .	107	Babyride . . . . .	124, 125
# 22172x . . . . .	107		
# 22177x . . . . .	107	<b>Triple Play (see Safeline Kids also)</b>	
# 22178x . . . . .	107	# 4002 . . . . .	126
# 22185x . . . . .	107	Sit'n'Stroll . . . . .	126
# 22188x . . . . .	107		
# 22195x . . . . .	107	<b>TRW</b>	
# 22356x . . . . .	115	ALL MODELS . . . . .	127
# 22412x . . . . .	107		
# 22449 . . . . .	109	<b>XSCi</b>	
# 22450 . . . . .	111	ALL MODELS . . . . .	128
# 22451 . . . . .	111		
# 22452 . . . . .	111		
# 22453 . . . . .	111		
# 22453x . . . . .	112		
# 22455 . . . . .	106		
# 22456x . . . . .	107		
# 22460 . . . . .	113		
# 22465x . . . . .	107		
# 22469x . . . . .	107		
# 22475x . . . . .	118		
# 22480 . . . . .	111		
# 22481 . . . . .	111		
# 22553x . . . . .	119		
# 22554x . . . . .	119		
# 22560x . . . . .	119		
# 22561x . . . . .	119		
# 22564x . . . . .	119		
# 22567x . . . . .	119		
# 22574x . . . . .	119		
# 22580x . . . . .	117		
# IC124 FSM . . . . .	116		
22439x . . . . .	109		
Alpha Elite . . . . .	105		
Alpha Omega . . . . .	106		
Alpha Omega All-N-1 . . . . .	107		
Alpha Omega Elite . . . . .	106, 107		
Alpha Sport . . . . .	108		
Avenue . . . . .	109		
Designer 22 . . . . .	110		

List #	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer Assistance Mfg Date Problem Type and Consumer Action
--------	-------------------------	--	--

1) **Alcot (Childcare)** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

2) **All Our Kids** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

**Alpha Elite (Dorel)**

**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141  
www.djgusa.com**

- |    |                     |                        |                   |   |
|----|---------------------|------------------------|-------------------|---|
| 3) | Alpha Luxe          | 22462x                 | 05/01/08-04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.  |
| 4) | Alpha Omega All-N-1 | 22459x                 | 05/01/08-04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.  |
|    | Alpha Omega Elite   | 22148x, 22149x, 22158x |                   |   |
| 5) | Comfort Infant Seat | 22331 BLA, 22332 RLA   | 07/26/05-02/28/06 | Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. |
| 6) | Comfort Infant Seat | 22331 BLA, 22332 RLA   | 07/26/05-02/28/06 | Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.               |

**Alpha Sport (Dorel)**

**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141  
www.djgusa.com**

- |    |         |                |                   |  |
|----|---------|----------------|-------------------|--|
| 7) | Enspira | 22452x, 22458x | 05/01/08-04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. |
| 8) | Vantage | 22546x, 22547x | 05/01/08-04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. |

9) **American Motors** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

**Baby Trend**

**800-328-7363 - www.babytrend.com**

- |     |                      |                  |                   |   |
|-----|----------------------|------------------|-------------------|---|
| 10) | Rigid Latch-Loc      | 6439, 6448, 6481 | 05/14/07-04/01/08 | Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced. |
| 11) | Rigid Latch-Loc Base | 6400             | 05/14/07-04/01/08 | Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced. |

12) **Babyhood Industries** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

13) **Basic Comfort** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

List #	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer Assistance Mfg Date	Problem Type and Consumer Action
--------	-------------------------	--	------------------------------	----------------------------------

14) **Beatrix Potter (Dorel)**

REFER TO OLDER MODELS LIST

**Bertini (Dorel)****Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141  
www.djgusa.com**

15) SureFit (Travel system) 22346x

05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

16) **Bolform Corp.****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****Britax****888-427-4829 / 704-409-1700 - www.britaxusa.com**

17) Boulevard E9L57

03/01/06-08/01/06 Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.

18) Chaperone E9L69N9, E9L69P2, E9L69P3, E9L69P5

04/01/09-05/31/10 The chest clip may break when it is engaged as the infant is secured into the infant car seat creating a safety hazard. Contact mfg. for repair kit.

19) Chaperone E9L692J, E9L692K, E9L692L, E9L692M

09/01/10-04/30/11 Voluntary Recall - The harness adjuster may detach from the shell due to an improperly installed rivet. Contact mfg. for repair kit.

20) Companion E9L14

10/31/03-06/06/04 One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.

21) Companion E9L14, E9L20, E9L80

Pre-11/01/07 User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels

22) Companion E9L14, E9L20, E9L80

All Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.

23) Decathlon E9L47

02/12/05-07/31/07 Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.

24) Frontier E9L54E7, E9L54H6, E9L54H7, E9L54M6

04/01/08-09/14/08 Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.

25) Frontier E9L5490

04/01/08-09/17/08 Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.

26) Husky E9L30

08/01/02-12/31/03 Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.

27) Husky E9L30

Pre-07/24/04 The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.

28) Marathon E9L06

Pre-07/24/04 The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.

29) Marathon E9L06, E9W06, E906 with top tether lot # KGR 01 A

05/23/06-07/28/06 The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.

30) Regent Classic E9L3998

12/18/06-01/18/07 Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b><i>Britax (continued)</i></b>				
31)	Regent	E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
32)	Traveller Plus	E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
33)	Wizard	E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
<hr/>				
34)	<b><i>Century Products</i></b>		<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
<hr/>				
<b><i>Chicco</i></b>			<b><i>800-807-8817 / 877-424-4226 - www.chiccousa.com</i></b>	
35)	Key Fit Key Fit 30 Cortina Travel Systems BASES ONLY	All	02/26/08-03/17/08	Recall applies only to bases manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained.
<hr/>				
36)	<b><i>Chrysler</i></b>		<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
<hr/>				
37)	<b><i>Collier-Keyworth</i></b>		<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>	
<hr/>				
<b><i>Combi USA</i></b>			<b><i>800-992-6624 / 803-548-6633 - www.combi-intl.com</i></b>	
38)	Avatar	8100	11/12/03-05/07/04	Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
39)	Centre ST Centre DX Centre EX Centre ARB	8065 8074 8086 8520	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
40)	Shuttle	8087	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
<hr/>				
<b><i>Compass Baby</i></b>			<b><i>888-899-2229 - www.compassbaby.com</i></b>	
41)	Infant Car Seat	I420 ARD I420 FUO I420 MAR	05/07/06, 05/13/06, and 05/15/06	The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit.
<hr/>				
<b><i>Cosco (Dorel)</i></b>			<b><i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i></b>	
42)	Alpha Omega Alpha Omega Elite	22150, 22180, 22269 22155	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b><i>Cosco (continued)</i></b>				
43)	Alpha Omega All-N-1	22150x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
44)	Alpha Omega Elite	22154x, 22155x, 22158x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
>> 45)	Comfy Carry	IC123 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
46)	Designer 22	22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
47)	DreamRide	22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
48)	High Rise Booster	22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
49)	Infant Car Seat	22-300 CSF, 22-300 FZN, 22-300 JJV, 22-300 OSF, 22-300 THD, 22-300 TWD	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Spirit and Sprint Travel Systems are affected.
50)	Regal Ride	22139MON	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
51)	Touriva	22100x, 22111x, 22130x, 93100x, 93111x	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
<hr/>				
<b><i>Cyber</i></b>			<b><i>Distributed by Regal Lager: 800-593-5522 - www.regallager.com</i></b>	
52)	Solution X-fix	0500200xx, 0500760xx	02/01/10-02/28/10	Booster seats have an incorrect warning statement about restraining unoccupied seats. Contact mfg. for replacement sticker and owner's manual.
<hr/>				
<b><i>Disney (Dorel)</i></b>			<b><i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i></b>	
53)	Infant Car Seat	22-305 NAB, 22-305 PPH, 22-355 LBF, 22-355 PWK, 22-627 AWF	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Propack Travel System are affected.
<hr/>				
54)	<b><i>Downunder</i></b>	<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>		
<hr/>				
<b><i>Eddie Bauer (Dorel)</i></b>			<b><i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i></b>	
55)	3-in-1 Deluxe 3-in-1 Deluxe Convertible	22740, 22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b><i>Eddie Bauer (continued)</i></b>				
56)	Alpha Omega Elite	22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
57)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
58)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
59)	Deluxe 3-in-1	22755x, 22758x, 22759x, 22790x, 22799x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
60)	Designer 22	22-625 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
61)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
62)	Enspira	22740x, 22741x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
63)	Infant Car Seat	22-627 CGT, 22-627 FRK, 22-627 KGS, 22-627 SNW, 22-627 WPR, 22-655 BYTE	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Adventurer and Endeavor Travel Systems are affected.
64)	Prospect Adjustable HiBack Booster	22880x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
65)	SureFit	22657x, IC072x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

***Evenflo******800-525-2472 / 800-233-5921 / 800-490-7497 - www.evenflo.com***

66)	Discovery	390, 391, 534, 552	Pre-02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
67)	Discovery	3021769Z, 3021854Z	02/04/08	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.
68)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre-04/08/06	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
69)	First Choice	3604098	01/16/09-09/29/09	A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.
70)	Maestro	3101198, 3101980, 31011048, 31011049, 31011059, 31011057C*	11/24/09-04/09/10*	A crack may form at the front of the seat adjacent to the harness adjuster in a crash. Evenflo recommends that the seat not be used with children < 40 pounds until repaired. Use as a booster for children > 40 pounds is OK. Call mfg. for free reinforcement kit. *Canadian seat 31011057C mfg dates: 12/17/09-04/26/10

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Evenflo (continued)**

- |     |         |                  |                   |   |
|-----|---------|------------------|-------------------|---|
| 71) | Tribute | 378x, 379x       | 09/08/05-09/22/05 | Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.   |
| 72) | Triumph | 264x, 359x, 389x | 09/06/01-10/31/05 | Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit. |

73) **Fisher Price** *REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS*

74) **Ford** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

75) **General Motors** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

76) **Gerry** *REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS*

**Graco****800-345-4109 - [www.gracobaby.com](http://www.gracobaby.com)**

- |     |              |   |                   |   |
|-----|--------------|---|-------------------|---|
| 77) | CarGo        | 8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x   | 01/09/07-03/03/08 | An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.  |
| 78) | ComfortSport | 8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x  | 01/02/07-07/31/07 | Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit <a href="http://gracobaby.com">gracobaby.com</a> website for additional info.   |
| 79) | ComfortSport | 8C02MRC2  | 10/22/07          | Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.   |
| 80) | ComfortSport | 8C04FRR, 8C04FRR2   | 11/01/06-10/08/07 | Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.  |
| 81) | SnugRide #'s | 8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342 | 03/01/02-03/08/03 | May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or <a href="http://www.gracobaby.com">www.gracobaby.com</a> for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.] |
| 82) | SnugRide     | 8609x, 8616x, 8643x, 8645x, 8646x   | 08/01/06-06/30/07 | The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.   |

83) **International** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

84) **Kolcraft** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

List #	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer Assistance Mfg Date	Problem Type and Consumer Action
--------	-------------------------	--	------------------------------	----------------------------------

85) **Lin Lih/MCP Ent.** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

**Maxi-Cosi (Dorel)**

**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141  
www.djgusa.com**

- |     |                         |  |                       |   |
|-----|-------------------------|--|-----------------------|---|
| 86) | Mico<br>Mico (base)     | 22-371, 22-372<br>22-515   | 07/01/07-<br>02/17/08 | Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base.  |
| 87) | Mico<br><br>Mico (base) | 22-371 HFL, 22-371 JUC,<br>22-371 LMD, 22-371 ORE,<br>22-371 PNG, 22-372 TTH<br>22-515 BLK | 02/18/08-<br>06/28/08 | Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for repair kit. NOTE: This is an extension of an earlier recall. |
| 88) | Mico                    | 22371x, 22372x   | 05/01/08-<br>04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.            |
| 89) | Priori                  | 22476x, 22486x   | 05/01/08-<br>04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.            |

**Mercedes-Benz USA**

**800-367-6372 - www.mbusa.com**

- |     |  |                                     |                       |  |
|-----|--|-------------------------------------|-----------------------|--|
| 90) | Kiddy TopSafe<br>(mfg. by<br>Sicartex) | B66868203<br>B66868204<br>B66868209 | 03/01/03-<br>11/30/03 | Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information. |
|-----|--|-------------------------------------|-----------------------|--|

**Mia Moda**

**866-642-6632 - www.miamodainc.com**

- |     |              |  |                       |  |
|-----|--------------|--|-----------------------|--|
| 91) | Viva         | 5000 (seat), 5001 (base)   | 12/19/06-<br>02/06/07 | The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.   |
| 92) | Viva         | 5000 (seat), 5001 (base),<br>5050 (seat), 5051 (base),<br>5070 (seat), 5071 (base) | 12/01/06-<br>05/31/09 | Sharp edges on the harness splitter plate can cut the harness. Also, the base could crack in a crash. Contact mfg. at 877-546-8437 for a full refund. <u>Mia Moda is urging parents/caregivers to discontinue use of the seat until it can be replaced.</u> According to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking. |
|     | Viva Supreme | 5080 (seat), 5081 (base)   |                       |  |

**Peg Perego USA**

**877-737-3468 / 219-482-8191 - www.perego.com**

- |     |                            |   |                       |  |
|-----|----------------------------|---|-----------------------|--|
| 93) | Jacadi                     | IMCB00JA57RJ31JU31  | 07/01/07-<br>03/14/08 | The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit.  |
| 94) | Primo Viaggio<br>SIP 30/30 | 32MD41KN41, 35CR13BU13,<br>35CR13PL46, 35CR24BU24,<br>35TL49KN53, 35TL53KN46,<br>61FG13ST53, 61FG53ST49,<br>61FG53ST64, 61ST13IC53,<br>61ST34IC53, 61ST48IC53 | 07/01/07-<br>03/14/08 | The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit.<br>Note: Affected model numbers begin with IMUN00US. |

95) **Playskool** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

96) **Pride Trimble/Virco** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
97)	<b>Questor</b>			<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
	<b>Recaro</b>			<b>800-873-2276 / 248-364-3818 - <a href="http://www.recaro-nao.com">www.recaro-nao.com</a></b>
98)	Como	331.00.xxx	Pre-09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
99)	Como	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
100)	Como	331.00.xxx, 331.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.
101)	Signo	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
102)	Signo	330.00.xxx, 330.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.
103)	<b>Renolux (FBS)</b>			<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
	<b>Safeline Kids (See Triple Play Products also)</b>			<b>800-829-1625 - <a href="http://www.tripleplayproducts.com">www.tripleplayproducts.com</a></b>
104)	Sit'n'Stroll	2003	09/01/02-10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.
	<b>Safety 1<sup>st</sup> (Dorel)</b>			<b>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 <a href="http://www.djgusa.com">www.djgusa.com</a></b>
105)	Alpha Elite	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
106)	Alpha Omega Alpha Omega Elite	22151 22455	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
107)	Alpha Omega All-N-1 Alpha Omega Elite	22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x, 22456x, 22465x, 22469x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
108)	Alpha Sport	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
109)	Avenue	22439x, 22449x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
110)	Designer 22	22-325 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.

List #	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer Assistance Problem Type and Consumer Action
<b>Safety 1st (continued)</b>				
111)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
112)	Enspira	22453x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
113)	Intera	22460	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
114)	Infant Car Seat	22-057 CLN, 22-057 DBY, 22-057 HRT, 22-057 LPH, 22-085 DWA, 22-085 LYN, 22-095 RBK, 22-322 HRR, 22-322 KDL, 22-322 LXI, 22-322 MAI, 22-322 OLY, 22-322 PRS, 22-322 PTK, 22-325 COB, 22-325 PAC, 22-380 LGA, 22-380 MSA, 22-627 WAV	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Eurostar, Explorer, Lite Wave, Sojourn, and Vector Travel Systems are affected.
115)	OnBoard	22077x, 22078x, 22356x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
>> 116)	OnBoard 35	IC124 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
117)	Prospect	22580x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
118)	Uptown	22475x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
119)	Vantage Vantage Point/ Surveyor Vantage Hiback	22553x, 22554x, 22560x, 22561x, 22564x, 22567x, 22574x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

**Snug Seat****800-336-7684 - www.snugseat.com**

120)	Gorilla	200-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
------	---------	----------	-------------------	--

**Snug Seat (continued)**

121)	Spelcast	600-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
122)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. <u>Contact Britax</u> at 800-683-2045 or 704-409-1700 for repair kit.

123) **Strolee****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer Assistance</i>
			<i>Mfg Date Problem Type and Consumer Action</i>

**Team-TEX America****877-912-1313**

124) Babyride 374099

08/31/06-10/23/06 Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to Team-TEX America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.

125) Babyride 374199

12/18/08 The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.

**TriplePlay Products  
(See Safeline Kids also)****800-829-1625 - [www.tripleplayproducts.com](http://www.tripleplayproducts.com)**

126) Sit'n'Stroll 4002

05/05/08 The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.

127) **TRW**

**REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

128) **XSCi**

**REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

*Integrated (built-into the vehicle) seats*

	<i>Manufacturer</i>	<i>Model Year</i>	<i>Customer Assistance</i>
	<b><i>Chrysler</i></b>		<b><i>800-853-1403 / 800-992-1997</i></b>
129)	Town and Country	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
130)	Town and Country	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
131)	Town and Country	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
132)	Town and Country	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
	<b><i>Dodge</i></b>		<b><i>800-853-1403 / 800-992-1997</i></b>
133)	Caravan Grand Caravan	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
134)	Caravan Grand Caravan	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
135)	Caravan Grand Caravan	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
136)	Caravan Grand Caravan	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
	<b><i>Ford</i></b>		<b><i>800-392-3673</i></b>
137)	Windstar	1998	The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.
	<b><i>Plymouth</i></b>		<b><i>800-853-1403 / 800-992-1997</i></b>
138)	Voyager Grand Voyager	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
139)	Voyager Grand Voyager	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
140)	Voyager Grand Voyager	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
141)	Voyager Grand Voyager	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.

Child restraints (CRs) manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of May 7, 2012.** Updated versions of this list and a listing of recalls on models less than 10 years old are posted on-line at [www.hsrc.unc.edu](http://www.hsrc.unc.edu).

## CHILD RESTRAINTS AT LEAST 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names. **Note:** Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

<i>Alcot (Childcare)</i>	# 11-565	234	# 4436	235, 236
Child Love Seat	# 11-570	233, 234	# 4446	235, 236
	# 11-575	234	# 4450	237, 238, 240, 241
<b>All Our Kids</b>	# 11-576	234	# 4460	237, 238, 239, 240, 241
# 600	# 11-578	234	# 44612	251
# 602	# 11-595	234	# 44622	247
Little Cargo Vest	# 11-597	233, 234	# 44630	247
	# 11-598	234	# 44631	247
<b>American Motors</b>	# 11-599	234	# 44662	247
Child Love Seat	# 11-600	233, 234	# 4470	238, 239, 240, 241
Infant Love Seat	# 11-650	233	# 44709	257
	# 12-565	253	# 4475	237, 238, 239, 240, 241
<b>Babyhood Industries</b>	# 4100	216, 217	# 4476	239, 240
# 810	# 4153	218	# 4480	239, 242
# 8200	# 4163	218	# 4490	239, 242
Baby-Sitter	# 4180	218	# 4500	254
Wonda Chair	# 4200	219, 220, 221, 222	# 4510	254
	# 4210	219, 220, 221, 222	# 45100	245
<b>Basic Comfort</b>	# 4214	219, 220, 221, 222	# 4513	253
# 960	# 4223	219, 220, 221, 222	# 4515	253
# 961	# 4235	219, 220, 221, 222	# 4516	253
Galaxy 2000	# 4253	223, 224, 225	# 4518	253
	# 4261	224, 225	# 4520	254
<b>Beatrix Potter (Dorel)</b>	# 4263	223, 224, 225	# 45200	245
# 02-620-xxx	# 4265	223, 224, 225	# 4525	255
# 02-621-SAL	# 4266	224, 225	# 4535	252
Designer 22	# 4300	226	# 4551	253
	# 4302	226	# 4557	253
<b>Bolform Corp.</b>	# 4303	226	# 4558	253
# 84E-019	# 4310	226	# 4559	253
Buckle-Up Harness	# 4323	226	# 4560	252
	# 4334	226	# 45600	245
<b>Britax</b>	# 4335	226	# 4564	253
# 101	# 4353	228, 229, 231	# 4565	252, 253
# 161	# 4365	228, 229, 230, 231	# 4566	253
# E902228	# 4365DT	227	# 4568	253
# E9031	# 4366	227, 228, 229, 230, 231	# 4569	253
Advantage	# 4367	230, 231	# 45700	245
Freeway	# 4368	228, 229, 230, 231	# 4575	246, 253
Roundabout	# 4369	230, 231	# 4576	253
Super Elite	# 4380	230, 232	# 4580	244
	# 4381	230	# 4581	243, 244
<b>Century</b>	# 4400	235, 236	# 4583	243, 244
# 11-564	# 4434	235, 236	# 4585	243, 244

**Century (Continued)**

# 4589	253	# 02-533	262	# 02821	284
# 4590	252	# 02-537	262	# 02825	284
# 4591	253	# 02-584-OXF	282	# 02935	284
# 4593	253	# 02-665	266	# 181A	272
# 4594	253	# 02-667	287	# 181B	272
# 4595	253	# 02-719 ARQ	268	# 22100	285
# 4597	253	# 02-727	266	# 313	274
# 4600	250	# 02-728	266	# 323	275
# 4662	251	# 02-729	266	# 423	275
# 4750	256	# 02-729 TED	265	# 81A	272
# 4875	248	# 02-731	266	# 81B	272
# 4885	249	# 02-732	266	# 93084	284
100	216, 217	# 02-733	266	# 93094	284
1000 STE	218	# 02-750	266	# 93443	270
200	219, 220, 221, 222	# 02-751	264, 266	# 93446	285
2000 STE	223, 224, 225	# 02-753	287	# 93504	285
300	226	# 02-755	266	# 93514	270, 284
3000 STE	227, 228, 229, 230, 231	# 02-756	266, 287	Alpha Omega	262, 263
3500 STE	232	# 02-757	266	Arriva	264, 265, 266
4-In-1	233, 234	# 02-758	287	Commuter	267
400XL	235, 236	# 02-759	287	Dream Ride	268
5000 STE	237, 238, 239, 240, 241	# 02-760	287	Hi Back Booster	269
5500 STE	242	# 02-761	287	Lxry Sft Shld Auto Trac	271
580	243, 244	# 02-762	287	Safe and Easy	274
Accel	245	# 02-763	287	Safe and Snug	275
Affinity	246	# 02-764	287	Safe-T Mate	273
Bravo	247	# 02-765	287	Safe-T-Shield	272
Bverra Contour	248	# 02-770	287	Sft Shld Auto Trac	278
Bverra Premiere	249	# 02-771	287	Soft Shield	277
Child Love Seat	250	# 02-772	287	Soft Shield Deluxe	279
Encore	251	# 02-774	266	Touriva	280, 281, 282, 283, 284, 285
Infant Car Seat	252, 253	# 02-790	271	Turnabout	287
Infant Love seat	254	# 02-821	283	Voyager Inf/Stroller	288
Smart Fit	255	# 02-890	271		
Smart Move	256, 257	# 02014	284	<b>Dorel</b>	
		# 02015	284	# 02-014-EMF (Cosco)	281
<b>Chrysler</b>		# 02019	284	# 02-014-GDM (Cosco)	281
Child Love Seat	258	# 02084	284	# 02-015-PDL (Cosco)	281
		# 02094	284	# 02-084 (Cosco)	280, 283
<b>Collier-Keyworth</b>		# 02114	284	# 02-086 (Cosco)	267
Co-Pilot	259	# 02332	263	# 02-090 (Cosco)	277, 278
Commuter	261	# 02409	269	# 02-094 (Cosco)	283
Safe and Sound II	260	# 02442	269, 270	# 02-096 (Cosco)	283
		# 02443	269, 270	# 02-190 (Cosco)	279
		# 02445	269	# 02-331 (Cosco)	262
<b>Cosco</b>		# 02448	269, 270	# 02-331 (Eddie Bauer)	290
# 02-014-EMF	281	# 02449	269	# 02-332 (Cosco)	262
# 02-014-GDM	281	# 02450	269	# 02-332 (Eddie Bauer)	290
# 02-015-PDL	281	# 02480	269	# 02-404 (Cosco)	283
# 02-084	280, 283	# 02495	269	# 02-514-BWE (Cosco)	282
# 02-086	267	# 02504	284	# 02-518-NDF (Cosco)	282
# 02-090	277	# 02514	284, 285	# 02-531 (Cosco)	262
# 02-094	283	# 02518	284	# 02-531 (Eddie Bauer)	290
# 02-096	283	# 02519	284, 285	# 02-533 (Cosco)	262
# 02-190	279	# 02524	284, 285	# 02-533 (Eddie Bauer)	290
# 02-290	278	# 02531	263	# 02-537 (Cosco)	262
# 02-331	262	# 02533	263	# 02-537 (Eddie Bauer)	290
# 02-332	262	# 02537	263	# 02-555 (Cosco)	262
# 02-404	283	# 02555	263	# 02-555 (Eddie Bauer)	290
# 02-514-BWE	282	# 02584	284	# 02-584-OXF (Cosco)	282
# 02-518-NDF	282	# 02803	284	# 02-620-xxx (Beatrix Potter)	209
# 02-531	262	# 02806	284	# 02-620-xxx (Safety 1st)	415

**Dorel (Continued)**

# 02-621-SAL (Beatrix Potter) . . . . . 209  
 # 02-621-SAL (Safety 1st) . . . . . 415  
 # 02-665 (Cosco) . . . . . 266  
 # 02-667 (Cosco) . . . . . 287  
 # 02-719 ARQ (Cosco) . . . . . 268  
 # 02-727 (Cosco) . . . . . 266  
 # 02-728 (Cosco) . . . . . 266  
 # 02-729 (Cosco) . . . . . 266  
 # 02-729 TED (Cosco) . . . . . 265  
 # 02-731 (Cosco) . . . . . 266  
 # 02-732 (Cosco) . . . . . 266  
 # 02-733 (Cosco) . . . . . 266  
 # 02-750 (Cosco) . . . . . 266  
 # 02-751 (Cosco) . . . . . 264, 266  
 # 02-753 (Cosco) . . . . . 287  
 # 02-755 (Cosco) . . . . . 266  
 # 02-756 (Cosco) . . . . . 266, 287  
 # 02-757 (Cosco) . . . . . 266  
 # 02-758 (Cosco) . . . . . 287  
 # 02-759 (Cosco) . . . . . 287  
 # 02-760 (Cosco) . . . . . 287  
 # 02-761 (Cosco) . . . . . 287  
 # 02-762 (Cosco) . . . . . 287  
 # 02-763 (Cosco) . . . . . 287  
 # 02-764 (Cosco) . . . . . 287  
 # 02-765 (Cosco) . . . . . 287  
 # 02-770 (Cosco) . . . . . 287  
 # 02-771 (Cosco) . . . . . 287  
 # 02-772 (Cosco) . . . . . 287  
 # 02-774 (Cosco) . . . . . 266  
 # 02-790 (Cosco) . . . . . 271  
 # 02-821 (Cosco) . . . . . 283  
 # 02-890 (Cosco) . . . . . 271  
 # 02014 (Cosco) . . . . . 284  
 # 02015 (Cosco) . . . . . 284  
 # 02019 (Cosco) . . . . . 284  
 # 02084 (Cosco) . . . . . 284  
 # 02094 (Cosco) . . . . . 284  
 # 02114 (Cosco) . . . . . 284  
 # 02332 (Cosco) . . . . . 263  
 # 02409 (Cosco) . . . . . 269  
 # 02409 (Eddie Bauer) . . . . . 291  
 # 02442 (Cosco) . . . . . 269, 270  
 # 02442 (Eddie Bauer) . . . . . 291  
 # 02443 (Cosco) . . . . . 269, 270  
 # 02443 (Eddie Bauer) . . . . . 291  
 # 02445 (Cosco) . . . . . 269  
 # 02445 (Eddie Bauer) . . . . . 291  
 # 02448 (Cosco) . . . . . 269, 270  
 # 02448 (Eddie Bauer) . . . . . 291  
 # 02449 (Cosco) . . . . . 269  
 # 02449 (Eddie Bauer) . . . . . 291  
 # 02450 (Cosco) . . . . . 269  
 # 02450 (Eddie Bauer) . . . . . 291  
 # 02480 (Cosco) . . . . . 269  
 # 02480 (Eddie Bauer) . . . . . 291  
 # 02495 (Cosco) . . . . . 269  
 # 02495 (Eddie Bauer) . . . . . 291  
 # 02504 (Cosco) . . . . . 284  
 # 02514 (Cosco) . . . . . 284, 285  
 # 02518 (Cosco) . . . . . 284

# 02519 (Cosco) . . . . . 284, 285  
 # 02524 (Cosco) . . . . . 284, 285  
 # 02531 (Cosco) . . . . . 263  
 # 02533 (Cosco) . . . . . 263  
 # 02537 (Cosco) . . . . . 263  
 # 02555 (Cosco) . . . . . 263  
 # 02584 (Cosco) . . . . . 284  
 # 02803 (Cosco) . . . . . 284  
 # 02806 (Cosco) . . . . . 284  
 # 02821 (Cosco) . . . . . 284  
 # 02825 (Cosco) . . . . . 284  
 # 02870 (Eddie Bauer) . . . . . 292  
 # 02871 (Eddie Bauer) . . . . . 292  
 # 02875 (Eddie Bauer) . . . . . 292  
 # 02935 (Cosco) . . . . . 284  
 # 181A (Cosco) . . . . . 272  
 # 181B (Cosco) . . . . . 272  
 # 219x (Cosco) . . . . . 286  
 # 22100 (Cosco) . . . . . 285  
 # 224x (Cosco) . . . . . 286  
 # 225x (Cosco) . . . . . 286  
 # 229x (Cosco) . . . . . 286  
 # 244x (Cosco) . . . . . 276  
 # 313 (Cosco) . . . . . 274  
 # 323 (Cosco) . . . . . 275  
 # 423 (Cosco) . . . . . 275  
 # 81A (Cosco) . . . . . 272  
 # 81B (Cosco) . . . . . 272  
 # 93084 (Cosco) . . . . . 284  
 # 93094 (Cosco) . . . . . 284  
 # 93443 (Cosco) . . . . . 270  
 # 93446 (Cosco) . . . . . 285  
 # 93504 (Cosco) . . . . . 285  
 # 93514 (Cosco) . . . . . 270, 284  
 3-in-1 (Eddie Bauer) . . . . . 290  
 Alpha Omega (Cosco) . . . . . 262, 263  
 Arriva (Cosco) . . . . . 264, 265, 266  
 Commuter (Cosco) . . . . . 267  
 Designer 22 (Beatrix Potter) . . . . . 209  
 Designer 22 (Safety 1st) . . . . . 415  
 Dream Ride (Cosco) . . . . . 268  
 Hi Back Booster (Cosco) . . . . . 269  
 Hi Back Booster (Eddie Bauer) . . . . . 291  
 Lxry Sft Shld Auto Trac (Cosco) . . . . . 271  
 Safe and Easy (Cosco) . . . . . 274  
 Safe and Snug (Cosco) . . . . . 275  
 Safe-T-Mate (Cosco) . . . . . 273  
 Safe-T-Shield (Cosco) . . . . . 272  
 Sft Shld Auto Trac (Cosco) . . . . . 278  
 Sidekick Booster (Cosco) . . . . . 276  
 Soft Shield (Cosco) . . . . . 277  
 Soft Shield Deluxe (Cosco) . . . . . 279  
 Touriva (Cosco) . . . . . 280, 284, 285  
 Touriva (Eddie Bauer) . . . . . 292  
 Touriva 5-point (Cosco) . . . . . 282  
 Touriva Shield (Cosco) . . . . . 281  
 Touriva T-Shield (Cosco) . . . . . 283  
 Trooper (Cosco) . . . . . 286  
 Turnabout (Cosco) . . . . . 287  
 Voyager Inf/Stroller (Cosco) . . . . . 288

**Downunder**  
 Kangaroo Booster . . . . . 289

**Eddie Bauer**  
 # 02-331 . . . . . 290  
 # 02-332 . . . . . 290  
 # 02-531 . . . . . 290  
 # 02-533 . . . . . 290  
 # 02-537 . . . . . 290  
 # 02-555 . . . . . 290  
 # 02409 . . . . . 291  
 # 02442 . . . . . 291  
 # 02443 . . . . . 291  
 # 02445 . . . . . 291  
 # 02448 . . . . . 291  
 # 02449 . . . . . 291  
 # 02450 . . . . . 291  
 # 02480 . . . . . 291  
 # 02495 . . . . . 291  
 # 02870 . . . . . 292  
 # 02871 . . . . . 292  
 # 02875 . . . . . 292  
 3-in-1 . . . . . 290  
 Hi Back Booster . . . . . 291  
 Touriva . . . . . 292

**Evenflo**  
 # 200x . . . . . 309  
 # 201 . . . . . 305  
 # 202 . . . . . 303, 305  
 # 203x . . . . . 306  
 # 205x . . . . . 306, 317, 318  
 # 206 . . . . . 307  
 # 207x . . . . . 308  
 # 210x . . . . . 306, 318  
 # 211x . . . . . 309  
 # 219164 . . . . . 320  
 # 219180 . . . . . 320  
 # 219186 . . . . . 320  
 # 219188 . . . . . 320  
 # 21940 . . . . . 320  
 # 219x . . . . . 286, 300, 314  
 # 221 . . . . . 311  
 # 222 . . . . . 312  
 # 223 . . . . . 312  
 # 224x . . . . . 286, 298, 299, 300, 314  
 # 225x . . . . . 286, 300, 314  
 # 227 . . . . . 324  
 # 228 . . . . . 316  
 # 229x . . . . . 286, 300, 313, 314  
 # 231 . . . . . 323  
 # 232 . . . . . 325  
 # 242 . . . . . 297  
 # 244x . . . . . 276  
 # 264x . . . . . 319  
 # 272x . . . . . 301  
 # 273x . . . . . 301  
 # 401 . . . . . 311  
 # 402 . . . . . 311  
 # 403 . . . . . 311  
 # 404 . . . . . 311  
 # 405 . . . . . 311

*Evenflo (Continued)*

# 406	311	Two-in-One	321	# 1382x	357, 369, 372, 379
# 407	311	Ultara 1	322, 323	# 13833	350, 371, 378
# 408	311	Ultara II	324, 325	# 1383x	354, 357, 369, 372, 379
# 409	311	<b>Fisher Price</b>		# 13842	350, 371, 378
# 410	293	# 79700	340	# 1384x	369, 372, 379
# 411	294	# 9100	326, 327, 328, 329, 330, 331, 332, 333, 334	# 13852	350, 371, 378
# 412	295	# 9101	327, 328, 330, 331, 332, 333, 334	# 1385x	372, 379
# 414	295	# 9104	335, 338, 339	# 138xx	356, 368, 370, 377
# 415	295	# 9149	336	# 140-155	365
# 416	295	# 9173	337	# 150-100	381
# 4176	312	Booster	338, 339	# 180-100	360
# 420	322	Car Seat	326, 327, 328, 329, 330, 331, 332, 333, 334	# 180-150	360, 361
# 435x	306	Delux Car Seat	335	# 180-200	351, 352, 361, 362
# 441	302, 303, 305	Infant Seat	336, 337	# 180-300	351, 352
# 442	302, 303, 305	Safe Embrace	340	# 180-400	365
# 443	302, 303, 305	<b>Ford</b>		# 180-600	349, 353
# 444	302, 303, 305	Infant Love Seat	341	# 180-601	349
# 445	302, 303, 305	<b>General Motors</b>		# 19127	358, 359
# 446	302, 303, 305	Child Love Seat	343	# 19128	358
# 447	302, 303, 305	Infant Love Seat	342	# 19129	358
# 447x	309	<b>Gerry</b>		# 19130	358
# 448	302, 303, 305	# 626	345	# 368xx	356, 357, 368, 369, 370, 372, 377
# 453	315, 316	Guardian	344	# 43xxx	355, 375
# 454	315, 316	Secure Ride	345	# 77001	366
# 456	304, 305	<b>Graco</b>		# 77002	366
# 458	304, 305	# 7493	347	# 77005	367
# 468x	301	# 7497	347	# 77007	367
# 469x	301	# 7499	347	Automate	349
# 470	296, 297	# 841101	347	Carter Travel 5	350
# 471	296, 297	# 841102	347	Dial-A-Fit	351, 352
# 476x	301	# 841103	347	Dial-A-Fit II	353
# 477x	301	# 841203	347	Flip 'N' Go	358
# 478x	301	# 841202	347	Flip 'N' Go II	359
# 480x	301	# 8457	347	Infant Car Seat	354
# 481x	301	# 8458	347	Infant Restraint	355
# 492x	308	# 8459	347	Infant Rider	356, 357
# 493x	306	# 8460	347	Perfect Fitt	360, 361, 362
# 499x	309	# 8462	347	Performa	363, 364
# 636x	321	# 8471	347	Playskool	365, 366
# 637x	321	# 8472	347	Playskool Infant	367
# 639001	310	# 8473	347	Plus 4	368, 369
# 639002	310	# 8474	347	Plus 5	370, 371, 372
410	293	# 8476	347	Rock 'N' Ride	373, 374
Bobby Mac Champion	294	# 8477	347	Secura	375
Bobby Mac Deluxe	295	# 8478	347	Secure Fit	376
Booster Seat	296, 297	GT 1000	346	Travel About	377, 378
Champion	298, 299, 300	SnugRide	347	Travel-About	379
Cozy Carry	301	<b>International</b>		Traveler 700	380, 381, 382
Dyn-O-Mite	302, 303	Astroseat	348	<b>Lin Lih/MCP</b>	
Infant Car Seat	304, 305	<b>Kolcraft</b>		# 180-200	384
Joyride	306	# 131-101	374	# 180-300	384
On My Way	307, 308, 309	# 13123	373	Lin Lih	383, 384
On My Way base	310	# 1312x	357	<b>Mercedes-Benz</b>	
One-Step	311			# BQ6910155	386
One-Step Deluxe	312			# BQ6910157	385
Scout	313, 314			# BQ691063	385
Seven Year Seat	315, 316			Booster Seat	385
Sidekick	276			Infant Restraint	386
Travel Tandem	317, 318				
Triumph	319				
Trooper	286, 320				

**Peg Perego**

# AL33USL	388
# AL33USN	388
# AL34USL	388
# AL34USN	388
# CS00MU1	387, 388
# CS00US1	387, 388
# CS00US8	387, 388
# LN34S09	388
# LN34S10	388
# LV34USL	388
# LV34USN	388
# ST33USL	388
# ST33USN	388
# ST38USL	388
# ST38USN	388
Primo Viaggio	387, 388

**Playskool**

# 140-155	389
# 180-400	389
# 77001	390
# 77002	390
# 77005	391
# 77007	391
Car Seat	389, 390
Infant Car Seat	391

**Pride Trimble/Virco**

# 832	394
# 890	392, 393
# 891	392, 393
# 892	392, 393
Click-n-Go	392, 393
Pride Ride	394

**Questor**

Kantwet Car Seat	395
------------------	-----

**Renolux (FBS)**

GT 1000	396
GT 2000	397, 398, 399
GT 4000	400, 401
GT 5000	402, 403
GT 5000 Turn A Tot	404, 405, 406
GT 5500	407, 408
GT 7000	409, 410, 411

**Safeline Kids**

# 3240	412
Sit'n'Stroll	412

**Safeline Kids (see Triple Play also)**

# 2240	414
# 3240	413
Sit'n'Stroll	413, 414

**Safety 1st (Dorel)**

# 02-620-xxx	415
# 02-621-SAL	415
Designer 22	415

**Strolee**

# 599	417
# 605	419
# 609	418
# 610	418
GT 3000	420
Quick Click	419
Wee Care	416, 417, 418

**TRW**

Child Love Seat	422
Infant Love Seat	421

**Volvo**

All	423
-----	-----

**XSCi**

Pioneered ACIS	424
----------------	-----

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
	<i>Model Name</i>		<i>Mfg Date</i> <i>Problem Type and Consumer Action</i>
<b><i>Alcot (Childcare)</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
200)	Child Love Seat		3/84-11/84      Plastic shell may develop cracks. Destroy & replace seat.
<b><i>All Our Kids</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
201)	Little Cargo Vest	600	4/93-3/94      Flammability of upholstery. Call mfg. for repair info.
202)	Little Cargo Vest	602	3/94-9/94      Flammability of upholstery. Call mfg. for repair info.
<b><i>American Motors</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
203)	Infant Love Seat	All	1/81-12/82      Plastic shell may develop cracks. Destroy & replace seat.
204)	Child Love Seat	All	3/84-11/84      Plastic shell may develop cracks. Destroy & replace seat.
<b><i>Babyhood Industries</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
205)	Wonda Chair	810	Pre 12/82      Harness may be misrouted. Call mfg. for instructions.
206)	Baby-Sitter	8200	1/92-6/93      Buckle. Call mfg. for repair info.
<b><i>Basic Comfort</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
207)	Galaxy 2000	960, 961	ALL      Crash test failure. Call mfg. for repair info.
208)	Galaxy 2000	960, 961	11/98-1/99      Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
<b><i>Beatrix Potter (Dorel)</i></b>			<b><i>Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i></b>
209)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02      Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
<b><i>Bolform Corp.</i></b>			<b><i>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</i></b>
210)	Buckle-Up Harness	84E-019	ALL      Crash test failure. Destroy & replace.
<b><i>Britax</i></b>			<b><i>888-427-4829 / 704-409-1700 www.britaxusa.com</i></b>
211)	Advantage	E902228	03/05/01-07/26/01      One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
212)	Freeway	101	6/96-4/97      Buckle. Call mfg. for repair info.
213)	Roundabout	161	1/99-3/99      Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
214)	Super Elite	E9031	04/25/01-02/15/02      Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Britax (continued)**

215)	Super Elite	E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
------	-------------	-------	-------------------	---

**Century Products****800-837-4044 / 216-468-2000**

216)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
217)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
218)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
219)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
220)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
221)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
222)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
223)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
224)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
225)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
226)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
227)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
228)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
229)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
230)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
231)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
232)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
233)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
234)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
235)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
236)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
237)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
238)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
239)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
240)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
241)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Century Products (continued)**

242)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
243)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
244)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
245)	Accel	45100, 45200, 45600, 45700	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
246)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
247)	Bravo	44622, 44630, 44631, 44662	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
248)	Brevera Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
249)	Brevera Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
250)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
251)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
252)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
253)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
254)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
255)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
256)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.
257)	Smart Move	44709	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

**Chrysler****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

258)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	-----------------	-----	------------	---

**Collier-Keyworth****800-544-1108**

259)	Co-Pilot	All	82-83	Shield. Call mfg. for repair info.
260)	Safe and Sound II	All	12/84-4/85	Buckle. Call mfg. for repair info.
261)	Commuter	All	10/87-02/88	Padding. Call mfg. for repair info.

**Cosco (Dorel)****Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141**

262)	Alpha Omega	02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00- 01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
------	-------------	---	--------------------	---

List #	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action
<i>Cosco (continued)</i>				
263)	Alpha Omega	02332, 02531, 02533, 02537, 02555	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
264)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
265)	Arriva	02-729 TED	03/31/99- 04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
266)	Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
267)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
268)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
269)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
270)	Hi Back Booster	02442, 02443, 02448, 93443, 93514	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
271)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
272)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
273)	Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
274)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
275)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
276)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
277)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
278)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
279)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
280)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
281)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
282)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
283)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
284)	Touriva	02014, 02015, 02019, 02084, 02094, 02114, 02504, 02514, 02518, 02519, 02524, 02584, 02803, 02806, 02821, 02825, 02935, 93084, 93094, 93514	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-----------------	---

***Cosco (continued)***

285)	Touriva	02514, 02519, 02524, 22100, 93446, 93504	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
286)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
287)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
288)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

***Downunder******No longer in business***

289)	Kangaroo Booster Seat	All (Pre- 1/98)		Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	-----------------	--	--

***Eddie Bauer (Dorel)******Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141  
www.djgusa.com***

290)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
291)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
292)	Touriva	02870, 02871, 02875	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

***Evenflo******800-525-2472 / 800-233-5921***

293)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
294)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
295)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
296)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
297)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
298)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
299)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
300)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
301)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	ALL (11/01/01-08/31/02)	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit <a href="http://www.cozycarry.com">www.cozycarry.com</a> or call 800-582-6698 for free kit.
302)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
303)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
304)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Evenflo (continued)**

305)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
306)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
307)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.
308)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
309)	On My Way	Begins with 200, 211, 447, 499	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
310)	On My Way base	639001, 639002	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
311)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
312)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
313)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
314)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
315)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
316)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
317)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
318)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
319)	Triumph	264x	10/20/01-01/31/02	Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.
320)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
321)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
322)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
323)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
324)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
325)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

**Fisher Price****ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE**

326)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
327)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
328)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
329)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
330)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
331)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
332)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
333)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Fisher Price (continued)**

334)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
335)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
336)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
337)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
338)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
339)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
340)	Safe Embrace	79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.

**Ford****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

341)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	------------------	-----	-------	---

**General Motors****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

342)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
343)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

**Gerry****Contact Evenflo: 800-525-2472 / 800-233-5921**

344)	Guardian	All	01/90-05/90	Buckle. Call mfg. for repair info.
345)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label

**Graco****800-345-4109 / www.gracobaby.com**

346)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
347)	SnugRide	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478	08/31/99-02/28/02	May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.

**International****ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

348)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
------	-----------	-----	------------	---------------------------------

**Kolcraft****ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

349)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
350)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
351)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
352)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
353)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

***Kolcraft (continued)***

354)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
355)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
356)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
357)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
358)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
359)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
360)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
361)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
362)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
363)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
364)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
365)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
366)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
367)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
368)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
369)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
370)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
371)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
372)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
373)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
374)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
375)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
376)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
377)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
378)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
379)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
380)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
381)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
382)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

***Lin Lih/MCP Ent.******ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***

383)	Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
384)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
<b>Mercedes-Benz USA</b>				
			<b>800-367-6372 - www.mbusa.com</b>	
385)	Booster	BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
386)	Infant Restraint	BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
<b>Peg Perego USA</b>				
			<b>877-737-3468 / 219-482-8191 - www.perego.com</b>	
387)	Primo Viaggio	CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
388)	Primo Viaggio	CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg. for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
<b>Playskool</b>				
			<b>Contact Kolcraft: 800-453-7673</b>	
389)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
390)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft
<b>Playskool (continued)</b>				
391)	Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
<b>Pride Trimble/Virco</b>				
			<b>800-521-5198</b>	
392)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
393)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
394)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.
<b>Questor</b>				
			<b>Contact Evenflo: 800-233-5921</b>	
395)	Kantwet Car Seat	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
<b>Renolux (FBS)</b>				
			<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>	
396)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
397)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
398)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
399)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.
400)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
401)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
402)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
403)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b>Renolux (continued)</b>				
404)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
405)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
406)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
407)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
408)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
409)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
410)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
411)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
<b>Safeline Kids</b>			<b>800-829-1625</b> <b>www.tripleplayproducts.com</b>	
412)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
413)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.
<b>Safeline Kids (continued)</b>				
414)	Sit'n'Stroll	2240	04/01/01-10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.
<b>Safety 1<sup>st</sup> (Dorel)</b>			<b>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141</b> <b>www.djgusa.com</b>	
415)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
<b>Strolee</b>			<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>	
416)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
417)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
418)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
419)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
420)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.
<b>TRW</b>			<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>	
421)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
422)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b>Volvo</b>			<b>800-458-1552 / 800-221-9136 / 201-768-7300</b>	
423)	ALL SEATS	All	Thru 12/88	Buckle. Call mfg. for refund info.

<i>List #</i>	<i>Manufacturer</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	
	<b>Model Name</b>		<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>

*XSCi*

**800-630-6850 / 719-593-8881**

424) Pioneered ACIS None\*

02/01/02-03/07/02

Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) \*No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] \*\*NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.\*\*